


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49249	Main Street: BOOMERANG_WY	Cross Street: PROSPERITY_VIEW_DR	Location: NW
ADA ID: 615450D2BB22	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 20	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

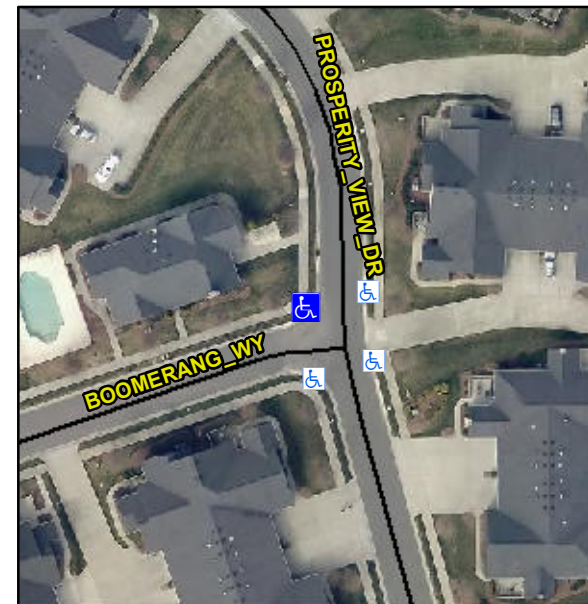

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2, R302.7, R302.7.2, R304.5.4, R304.5.3

Street 1 Name	BOOMERANG WY
Stop Condition-Street 1	StopSign
Street 2 Name	PROSPERITY VIEW DR
Stop Condition-Street 2	None

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	Yes	BlendTrans Slope (%)	3.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	8.7	N/A	Flare Slope RT (%)	5.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	66.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	7.3
No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	5.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	2.2
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0		Clear Space?	Yes
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	6.2

