


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8041		Main Street: AUSTIN_DR		Cross Street: N_TRYON_ST		Location:		NW	
ADA ID: 61665BFACDB9		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 15	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 Possible Solutions: Remove & Replace Entire Ramp. Remove & Replace Gutter. Surveyor Notes: N/A PROW/ADA: R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2, R302.7.2 Street 1 Name AUSTIN DR Stop Condition-Street 1 StopSign Street 2 Name N/A Stop Condition-Street 2 N/A Total Cost: \$ 2350.00				Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	134.0	Yes	Grade Break?	Yes
				Yes	Ramp Width (in)	69.0	Yes	Grade Break Slope (%)	2.6
				Yes	Ramp Slope (%)	8.2	No	Grade Break XSlope (%)	2.9
				Yes	Ramp XSlope (%)	1.7			
				Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
				Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
				Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
				No	Landing Slope (%)	3.2	Yes	DWS Length (in)	24.0
				Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
				N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	61.0
				N/A	Shared Landing?	No	No	DWS Offset RT (in)	3.0
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.5
				No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	4.6
				N/A	Painted X Walk1?	No		Road Slope (%)	0.9
					X Walk 1 Direction	To S		Road X Slope (%)	3.7
					X Walk 1 Width (in)	N/A		Clear Space?	Yes
					X Walk 1 Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)	3.7	Yes	Storm Grate/Utility Hazard?	No
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				Yes	Any Obstructions?	No			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	5.4

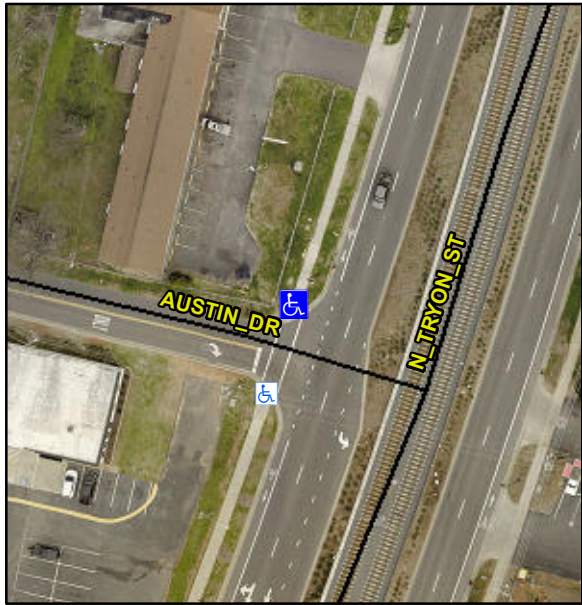