


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6328	Main Street: E_W_T_HARRIS_RA	Cross Street: UNIVERSITY_CITY_BV	Location: NE
ADA ID: 62AFF89A7AA7	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 17.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

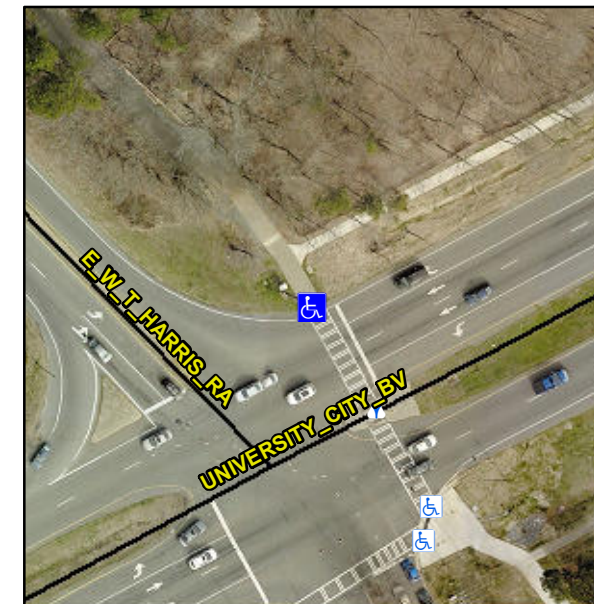

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

NO CURB

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R305.1.4, R305.2, R302.7, R302.7.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	123.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	120.0	Yes	Grade Break Slope (%)	2.3
Yes	Ramp Slope (%)	5.2	Yes	Grade Break XSlope (%)	2.6
Yes	Ramp XSlope (%)	1.1			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	120.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	120.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.0	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.8	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	8.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	16.0
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.0
No	Gutter Lip Ht (in)	0.8	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.8
	X Walk 1 Direction	To S		Road X Slope (%)	3.0
	X Walk 1 Width (in)	109.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Total Cost: \$ 1800.00

