

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 17443 Main Street: E EXMORE ST **Cross Street: OLD PINEVILLE RD** Location: SW **ADA ID: 62BB741AEF8D** Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

None

Field Measurements/Component Compliance

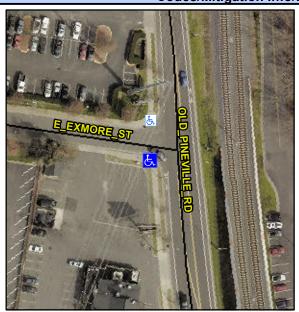

OLD PINEVILLE RD Street 1 Name Stop Condition-Street 2 Street 2 Name **E EXMORE ST** Stop Condition-Street 1 StopSign

Possible Solutions: **Remove & Replace Curb Ramp With Two New Directional Ramps or** Equivalent. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2, R304.5.3

3200.00

Comp	liance Description	Data	Comp	liance	Description	Data
N/A	Ramp Length (in)	76.0	No	Ramp	Slope (%)	11.1
Yes	Ramp Width (in)	48.0	No	Ramp	XSlope (%)	2.2
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Walk 1 Direction	To E		X Wa	lk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.9		X Wa	lk 2 Slope (%)	6.3
	X Walk 1 X Slope (%)	2.6		X Wa	lk 2 X Slope (%)	2.
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	2.0	N/A	Clear	Space?	N/A
	Road X Slope (%)	8.0	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm	n Grate/Utility Type	
		N/A				N/A
			Yes	Surfa	ce Condition? (G/P)	Good





Total Cost:

