


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7762	Main Street: N_GRAHAM_ST	Cross Street: W_CRAIGHEAD_RD	Location: SE
ADA ID: 62BE2A226E9B	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

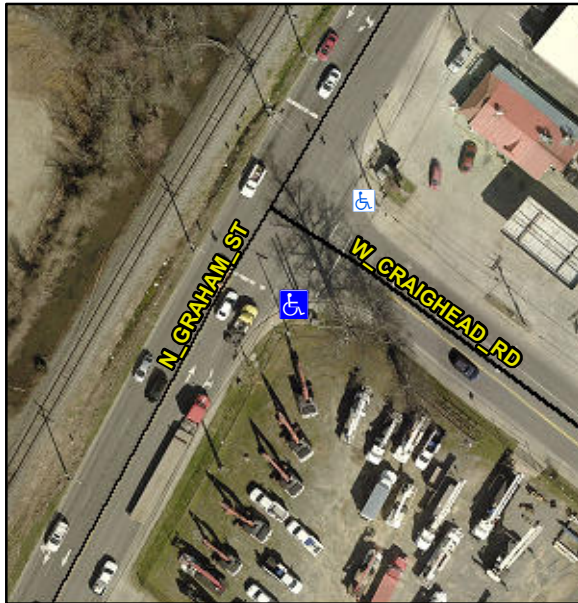

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

DAMAGED CURB, LT RP < 5%

PROW/ADA:

R304.5.3, R304.3.2

Street 1 Name	W CRAIGHEAD RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	62.0	N/A	Ramp Length RT (in)	66.5
Yes	Ramp Width LT (in)	59.5	Yes	Ramp Width RT (in)	59.5
Yes	Ramp Slope LT (%)	4.6	No	Ramp Slope RT (%)	8.7
No	Ramp XSlope LT (%)	2.6	Yes	Ramp XSlope RT (%)	0.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	103.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	18.0

