

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11677	Main Street: W_11TH_ST	Cross Street: N_TRYON_ST	Location: N
ADA ID: 63E96545E68E	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

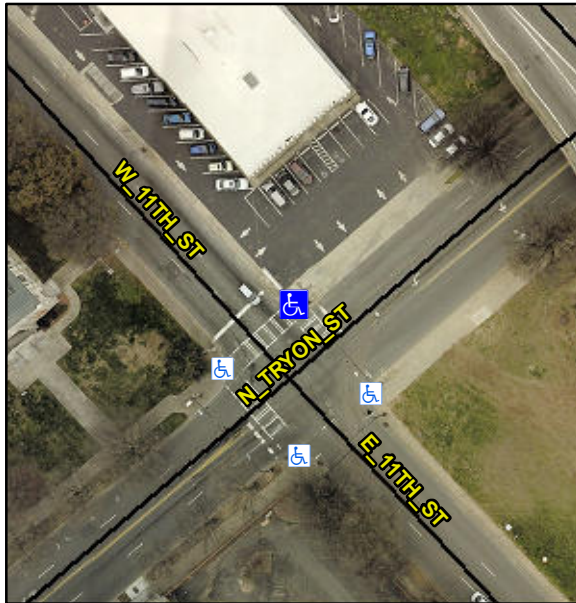

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2

Street 1 Name	W 11TH ST
Stop Condition-Street 1	Signal
Street 2 Name	N TRYON ST
Stop Condition-Street 2	Signal

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	68.0	Yes	BlendTrans Slope (%)	2.2
Yes	Ramp Width (in)	56.0	Yes	BlendTrans XSlope (%)	2.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	0.8	N/A	Flare Slope RT (%)	1.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	14.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	110.0		X Walk 2 Width (in)	113.0
	X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	7.3
	X Walk 1 X Slope (%)	5.4		X Walk 2 X Slope (%)	1.6
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	4.5		Clear Space?	Yes
	Road X Slope (%)	6.3	Yes	Clear Space to XWalk (in)	70.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.5

