


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3448	Main Street: W W T HARRIS BV TO I-77 RA SB	Access Street: I-77 TO W W T HARRIS BV RA SB	Location: NW
ADA ID: 6403FA12CB2B	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

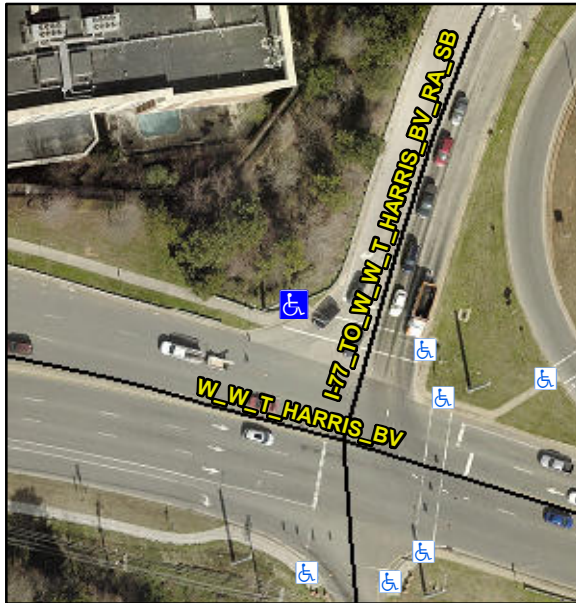

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, R302.7, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	67.0	N/A	Ramp Length RT (in)	64.0
Yes	Ramp Width LT (in)	62.0	Yes	Ramp Width RT (in)	62.0
Yes	Ramp Slope LT (%)	7.1	Yes	Ramp Slope RT (%)	7.1
No	Ramp XSlope LT (%)	2.5	No	Ramp XSlope RT (%)	3.1
Yes	Landing Length (in)	66.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	5.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	136.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.3

Total Cost: \$ 2350.00

