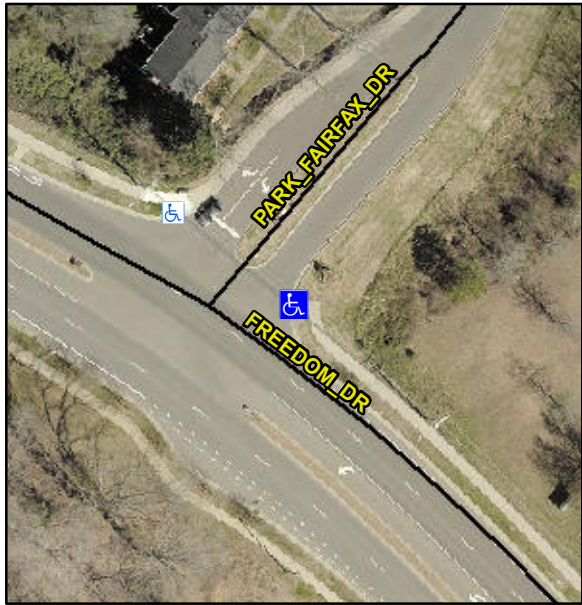


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8305	Main Street: FREEDOM_DR	Cross Street: PARK_FAIRFAX_DR	Location: SE
ADA ID: 6486F56D81AD	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	84.0	Yes	Ramp Slope (%)	7.0
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.4
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	6.2	N/A	Flare Slope RT (%)	6.0
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	50.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.7	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	2.1	Yes	DWS Full Width?	Yes
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.8
PROW/ADA:		R304.5.3	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.4
			Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.3
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	1.7
				X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	3.3
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.0	N/A	Clear Space?	Yes
				Road X Slope (%)	4.8	N/A	Clear Space to XWalk (in)	31.5
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

