


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040846	Main Street: WAKEFIELD_DR	Cross Street: N/A	Location: NE
ADA ID: 64B52E6F3773	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
		Severity Score: 10	

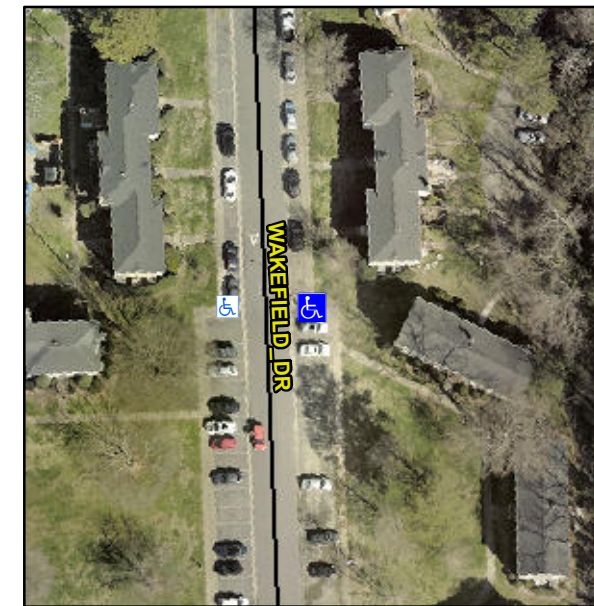

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R305.1.4, R305.2, R302.7.2**

Total Cost: \$ 2050.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	51.0	Yes	Ramp Slope (%)	5.3
Yes	Ramp Width (in)	50.0	Yes	Ramp XSlope (%)	1.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.9	Yes	Flare Slope RT (%)	4.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	46.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	54.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	6.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.7
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

