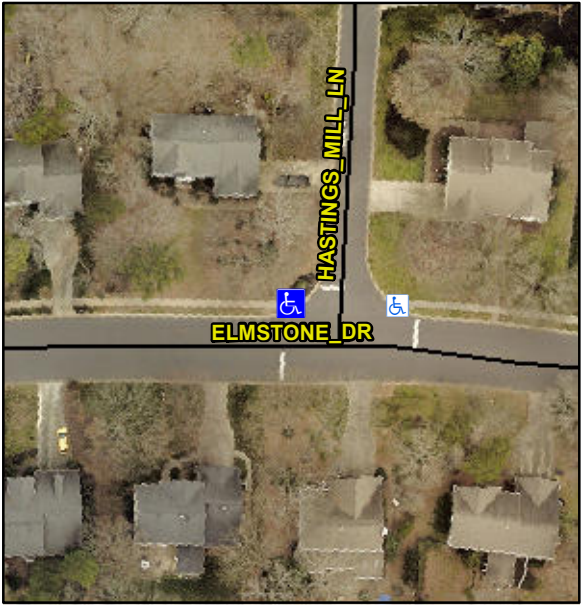
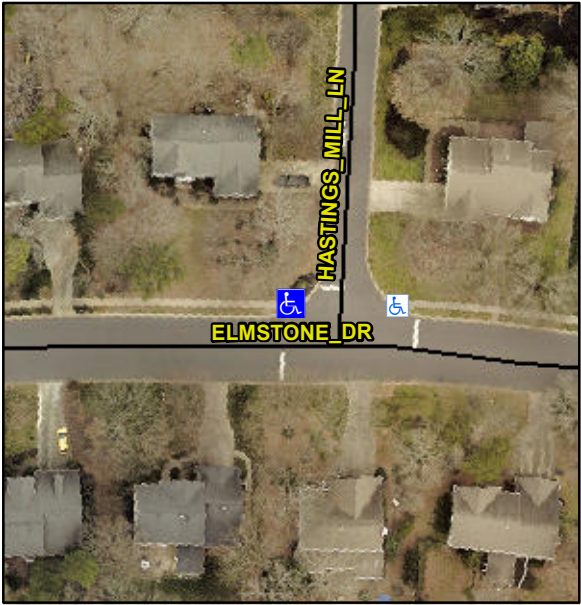
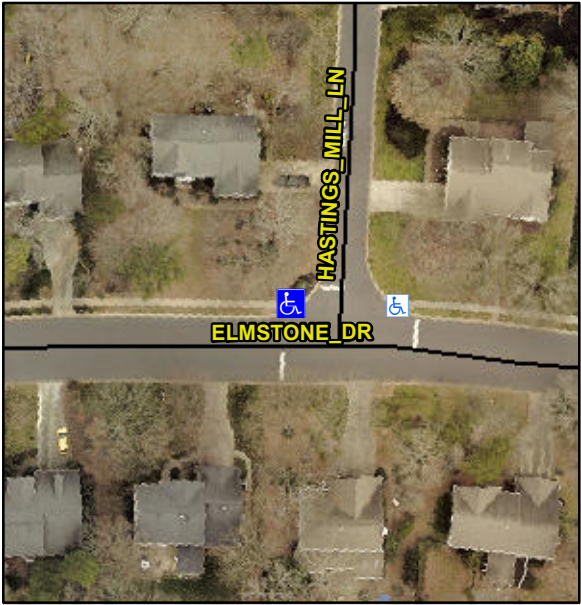
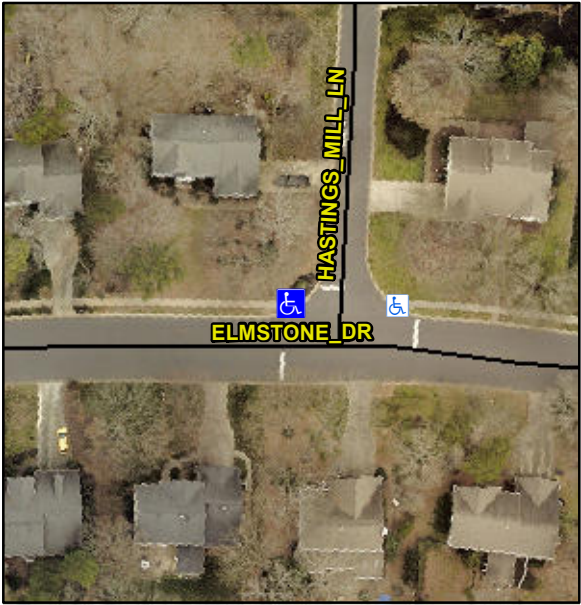
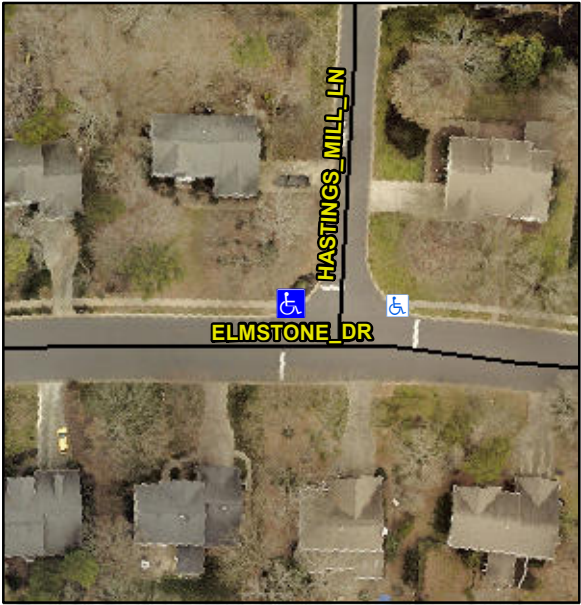
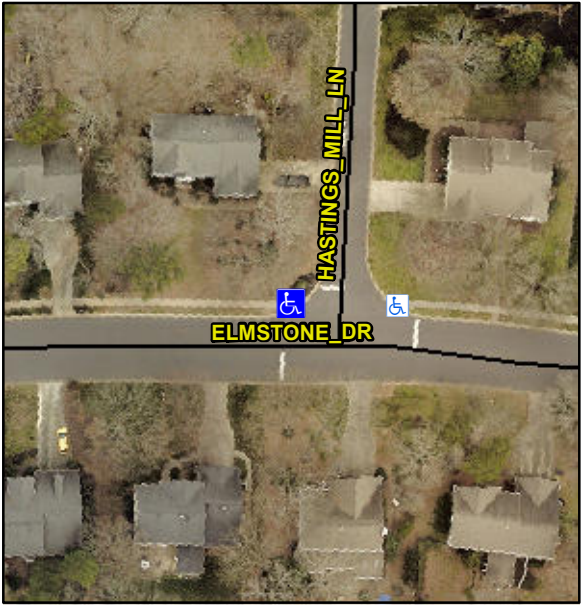
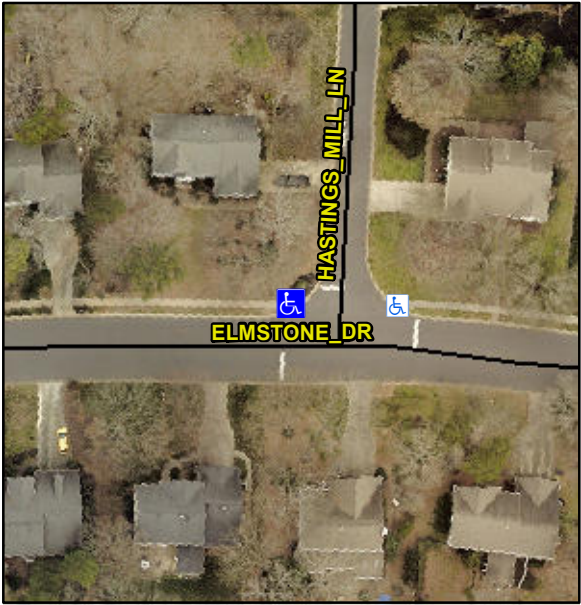
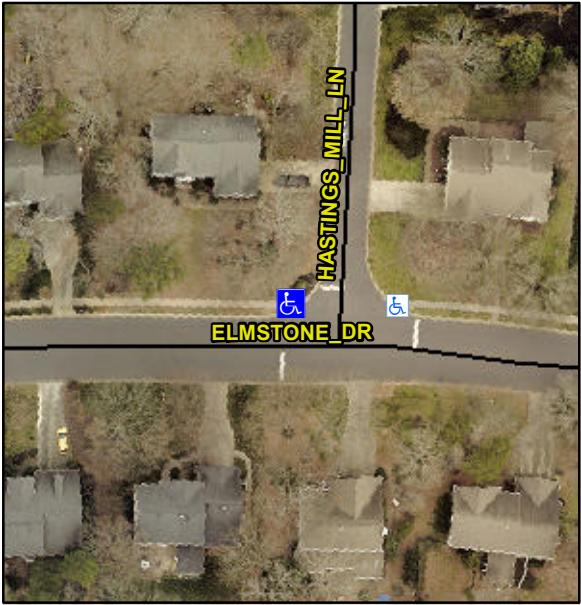
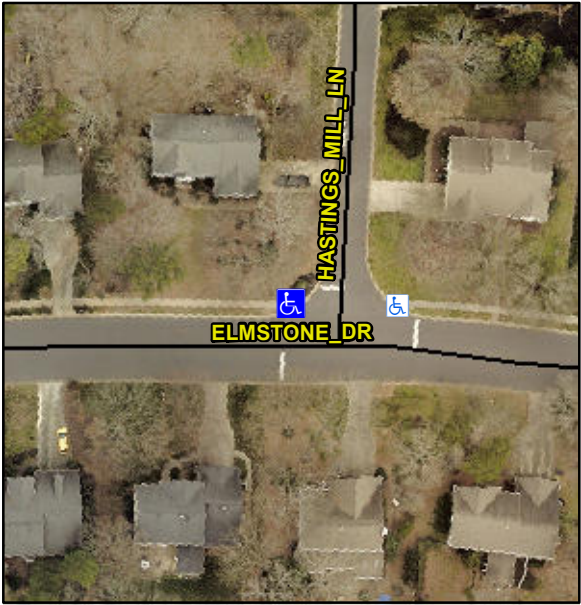
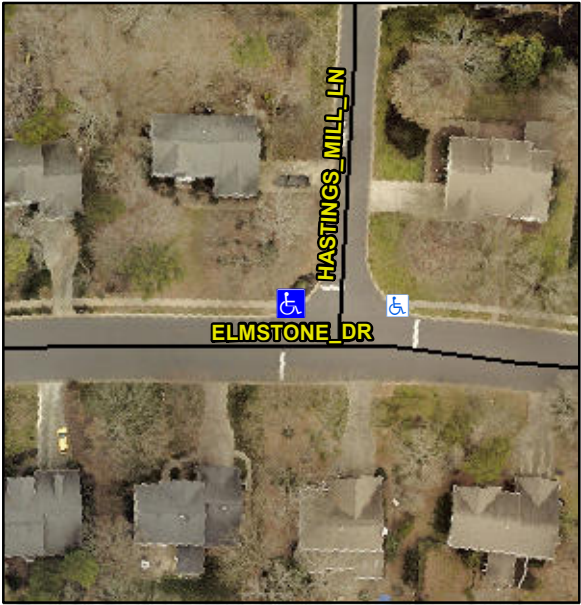
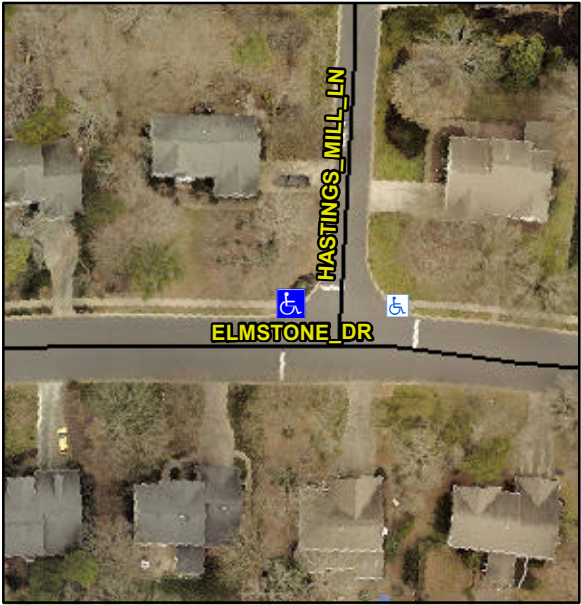
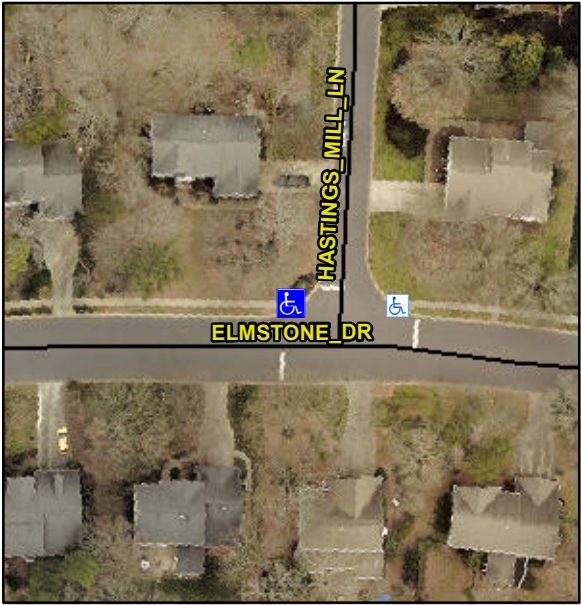
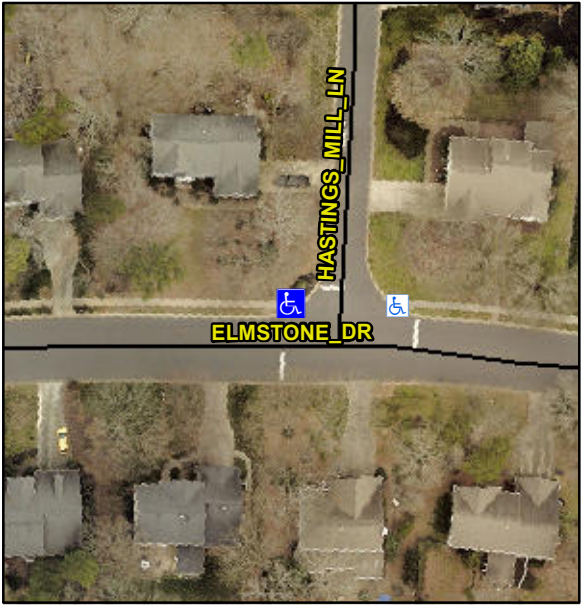
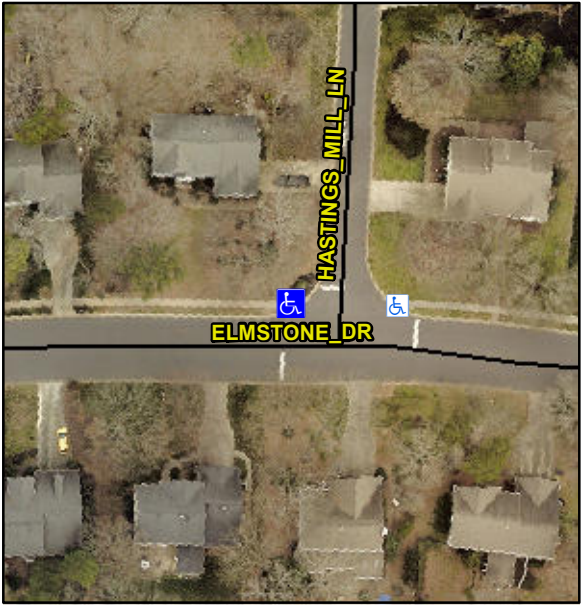
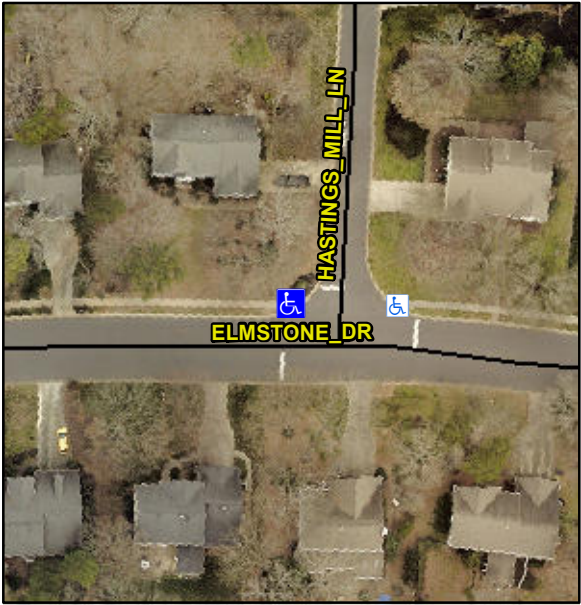
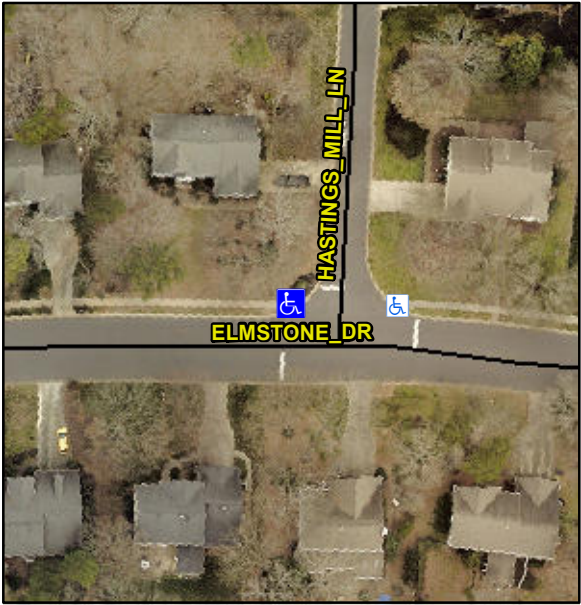
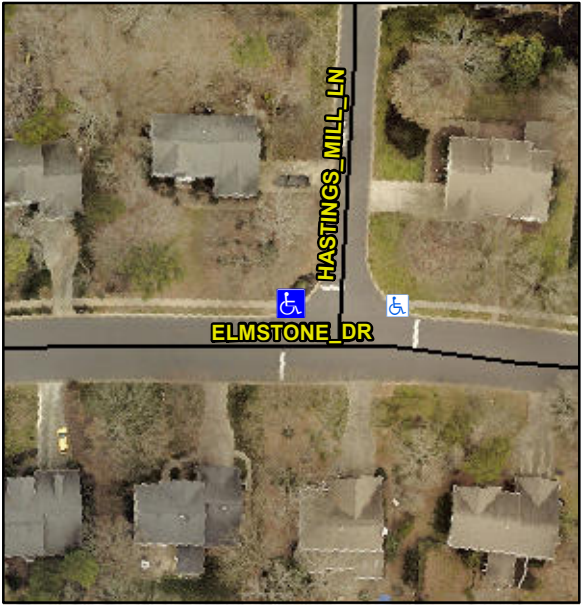
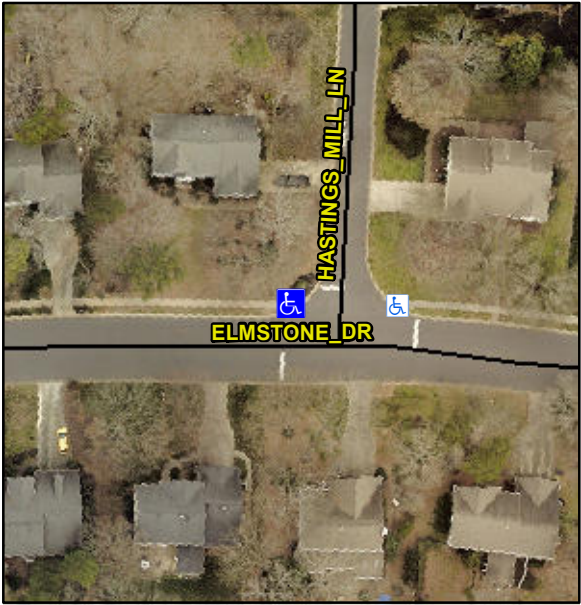
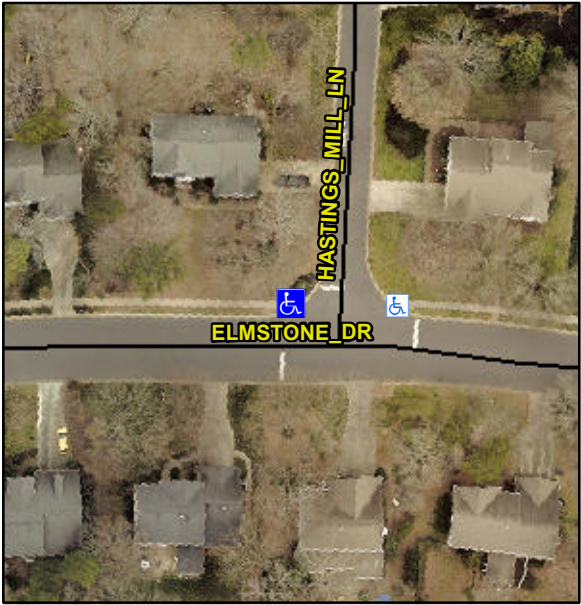
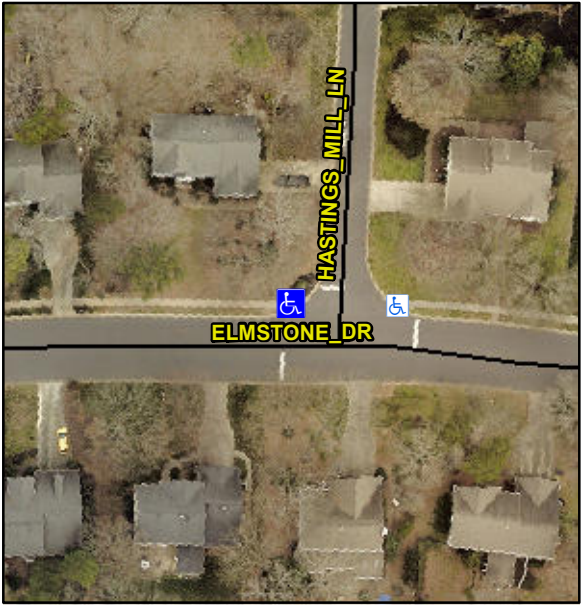


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27273	Main Street: ELMSTONE_DR	Cross Street: HASTINGS_MILL_LN	Location: NW
ADA ID: 64BF8E44C7E6	Ramp Type: Perpendicular Diagonal	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:	Compliance	Description	Data	Compliance
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	Description	Data	Compliance	Description
	Surveyor Notes:	Data	Compliance	Description	Data
	N/A	N/A	Yes	Ramp Length (in)	28.0
	PROW/ADA:	Yes	No	Ramp Width (in)	48.0
	Not Found, R304.5.3	N/A	N/A	Flare Type LT	N/A
		N/A	N/A	Flare Slope LT (%)	N/A
		N/A	N/A	Flare Slope RT (%)	N/A
		N/A	N/A	Flare Traversable LT?	N/A
		N/A	N/A	Flare Traversable RT?	N/A
		N/A	N/A	Landing Length (in)	N/A
		N/A	N/A	Landing Width (in)	N/A
		N/A	N/A	Landing Slope (%)	N/A
		N/A	N/A	Landing X Slope (%)	N/A
		N/A	N/A	Landing Curb? (Y/N)	N/A
		N/A	N/A	Shared Landing?	N/A
		N/A	N/A	Gutter Ponding?	N/A
		N/A	N/A	Gutter Lip Ht (in)	N/A
		N/A	N/A	Painted X Walk1?	No
		N/A	N/A	Painted X Walk2?	No
		N/A	N/A	X Walk 1 Direction	To S
		N/A	N/A	X Walk 2 Direction	To E
		N/A	N/A	X Walk 1 Width (in)	N/A
		N/A	N/A	X Walk 2 Width (in)	N/A
		N/A	N/A	X Walk 1 Slope (%)	1.7
		N/A	N/A	X Walk 2 Slope (%)	2.9
		N/A	N/A	X Walk 1 X Slope (%)	2.4
		N/A	N/A	X Walk 2 X Slope (%)	3.3
		N/A	N/A	Ramp inside XWalk1?	N/A
		N/A	N/A	Ramp inside XWalk2?	N/A
		N/A	N/A	Road Slope (%)	1.9
		N/A	N/A	Clear Space?	N/A
		N/A	N/A	Road X Slope (%)	6.0
		N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	N/A	Any Obstructions?	N/A
		N/A	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	N/A	Obstruction Type	N/A
		N/A	N/A	Storm Grate/Utility Type	N/A
		N/A	N/A	Surface Condition? (G/P)	Good
		N/A	N/A		

Total Cost: \$ 3200.00

