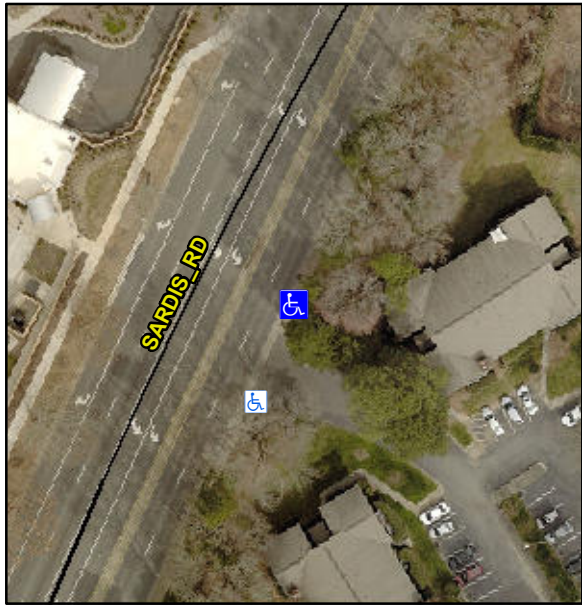


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10037292	Main Street: SARDIS_RD	Cross Street: N/A	Location: E
ADA ID: 64F82AD57EC8	Ramp Type: Perpendicular Diagonal	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	59.0	No	Ramp Slope (%)	9.8		
			No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	2.0		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
Surveyor Notes:		N/A			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.5.1, R304.2.2			N/A	Shared Landing?	N/A			
					N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
					N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
					N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
						X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
					N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
						X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	3.4
						X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	1.2
Street 1 Name		SARDIS RD		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
Stop Condition-Street 2		None			Road Slope (%)	2.0	N/A	Clear Space?	N/A	
Street 2 Name		ENTRANCE			Road X Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A	
Stop Condition-Street 1		None		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
						Obstruction Type		Storm Grate/Utility Type		
							N/A		N/A	
							Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 3200.00								

