


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A		Main Street: FREEDOM_DR		Cross Street: N_I-85_RA		Location: E							
ADA ID: 65751601CF10		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 7.5					
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance									
 Possible Solutions: Remove & Replace Entire Ramp. Grind Gutter Lip. Surveyor Notes: N/A PROW/ADA: R304.5.3, R305.2, R302.7.2				Compliance	Description	Data	Compliance	Description	Data				
				N/A	Ramp Length (in)	50.0	Yes	Grade Break?	Yes				
				Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	0.9				
				Yes	Ramp Slope (%)	0.1	Yes	Grade Break XSlope (%)	1.3				
				Yes	Ramp XSlope (%)	1.4							
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A				
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A				
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
				Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes				
				Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes				
				Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0				
				No	Landing X Slope (%)	2.3	Yes	DWS Full Width?	Yes				
				N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	4.0				
				N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	16.0				
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8				
				No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.4				
				N/A	Painted X Walk1?	Yes		Road Slope (%)	1.3				
					X Walk 1 Direction	To NW		Road X Slope (%)	1.1				
					X Walk 1 Width (in)	100.0		Clear Space?	Yes				
					X Walk 1 Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A				
					X Walk 1 X Slope (%)	1.1	Yes	Storm Grate/Utility Hazard?	No				
				Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type					
				Yes	Any Obstructions?	No			N/A				
					Obstruction Type		Yes	Surface Condition? (G/P)	Good				
							N/A	Curb Slope (%)	0.8				
				Total Cost:				\$	1800.00				

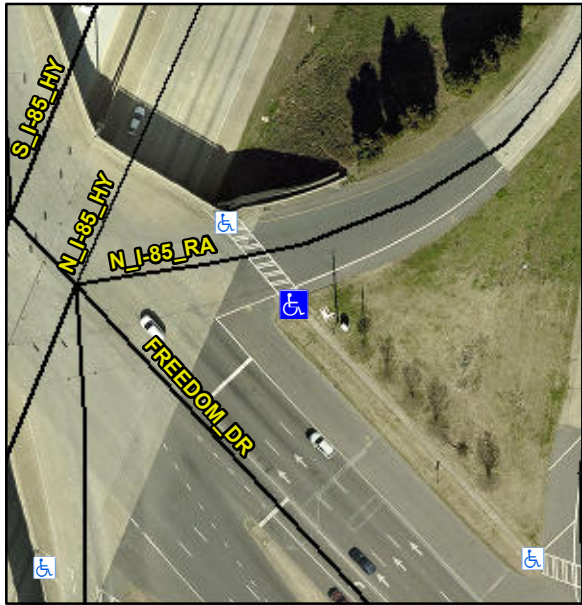