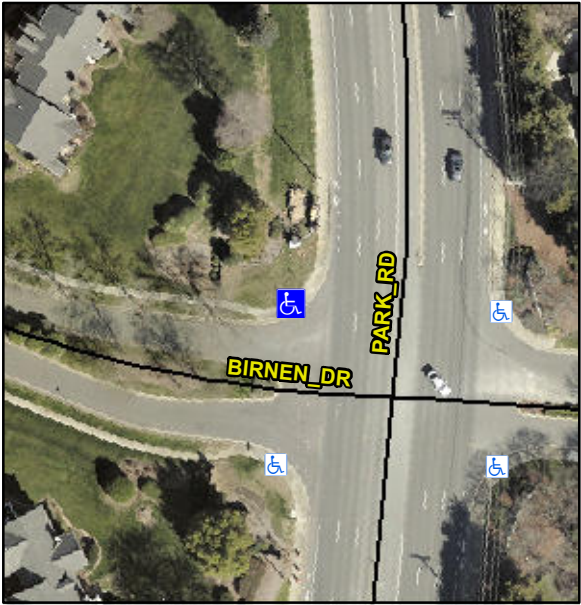


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 25066	Main Street: BIRNEN_DR	Cross Street: PARK_RD	Location: NW
ADA ID: 6615E200DB66	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	60.0
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
				X Walk 1 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	0.9
				X Walk 1 X Slope (%)	0.7
			N/A	Ramp inside XWalk1?	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2			N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	0.0
				Road X Slope (%)	1.2
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	BIRNEN DR
Stop Condition-Street 2	StopSign
Street 2 Name	PARK RD
Stop Condition-Street 1	None

Total Cost: \$ 3200.00

