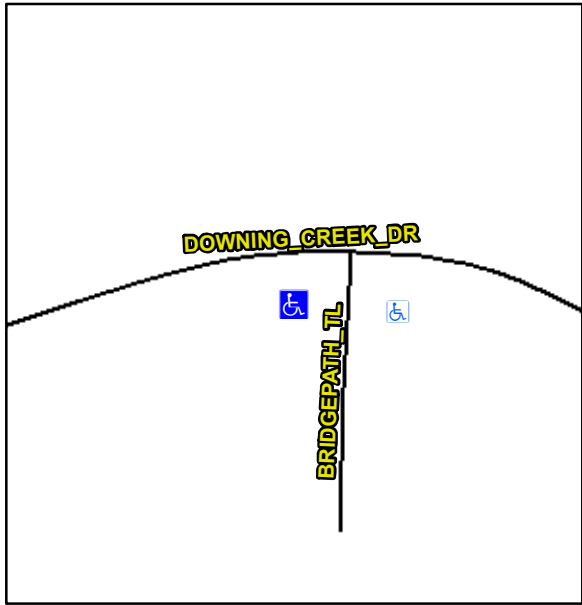


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3991	Main Street: BRIDGEPATH_TL	Cross Street: DOWNING_CREEK_DR	Location: W
ADA ID: 66B74E145DB7	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 21.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:				
	<b>Remove &amp; Replace Entire Ramp.</b>				
	Surveyor Notes:				
	<b>N/A</b>				
	PROW/ADA:				
	<b>R304.5.1, R304.5.3</b>				
	Street 1 Name	<b>BRIDGEPATH TL</b>			
	Stop Condition-Street 1	<b>StopSign</b>			
	Street 2 Name	<b>N/A</b>			
	Stop Condition-Street 2	<b>N/A</b>			
Total Cost:		\$	<b>1600.00</b>		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	N/A	Grade Break?	N/A
No	Ramp Width (in)	40.5	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	5.2	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	6.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	4.7
	X Walk 1 Direction	To NE		Road X Slope (%)	5.2
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	4.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	5.2	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	18.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	N/A	Grade Break?	N/A
No	Ramp Width (in)	40.5	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	5.2	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	6.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	4.7
	X Walk 1 Direction	To NE		Road X Slope (%)	5.2
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	4.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	5.2	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	18.4

