


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27872	Main Street: BALLANTYNE_COUNTRY_CLUB_DR	Cross Street: LETHCO_WY	Location: NW
ADA ID: 66CCB22C0913	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

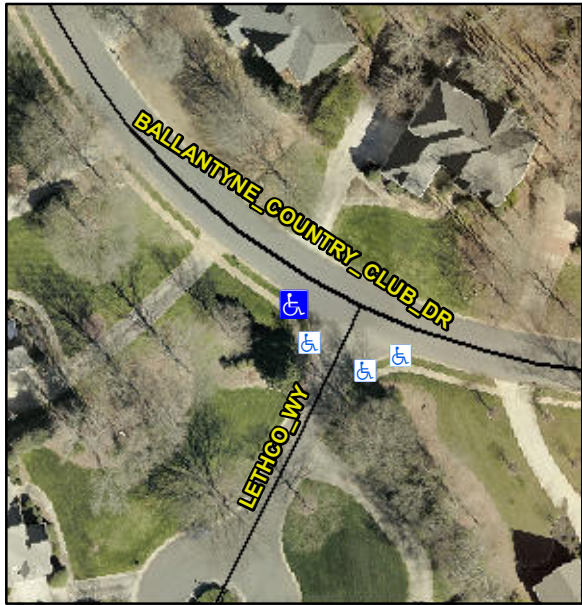

Street 1 Name

BALLANTYNE COUNTRY CLUB DR

Stop Condition-Street 2

None

Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost:

\$

1850.00

Compliance		Description	Data	Compliance	Description	Data
N/A		Ramp Length (in)	50.0	No	Ramp Slope (%)	10.3
Yes		Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.9
N/A		Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A		Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A		Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A		Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A		Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A		Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A		Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A		Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A		Shared Landing?	N/A			
N/A		Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A		Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A		Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
		X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A		X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A		Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A	N/A	Clear Space?	N/A
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A		Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A
				Yes	Surface Condition? (G/P)	Good

