


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 28605Main Street:FOX\_THORNE\_DRCross Street:MT\_HOLLY-HUNTERSVILLE\_RDLocation:NWADA ID: 66F9BC17962ERamp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:22.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

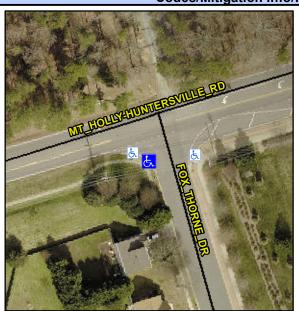

Street 1 Name FOX THORNE DR
Stop Condition-Street 2 StopSign
Street 2 Name N/A
Stop Condition-Street 1 N/A

Total Cost: \$ 1850.00

Field Measurements/Component Compnance						
	Compliance Description		Data	Compliance Description		Data
	N/A	Ramp Length (in)	46.5	No	Ramp Slope (%)	11.6
	No	Ramp Width (in)	36.5	No	Ramp XSlope (%)	4.0
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
	N/A	Shared Landing?	N/A			
	N/A	Gutter Ponding?	Yes	N/A	Gutter Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
		X Walk 1 Direction	To S		X Walk 2 Direction	N/A
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	4.6		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	N/A
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A	N/A	Clear Space?	N/A
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A
				Yes	Surface Condition? (G/P)	Good
	- E - S					





