

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49149	Main Street: OLD_PROVIDENCE_LN	Cross Street: DACAVIN_DR	Location: SW
ADA ID: 672F0D7C2D30	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

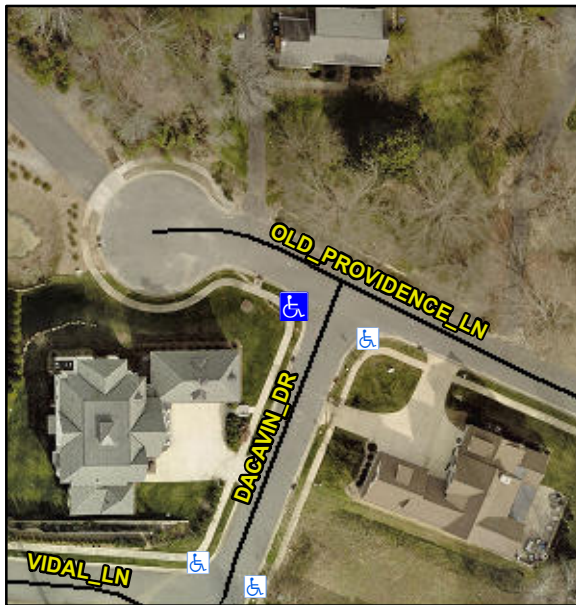

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.1, R304.5.3

Street 1 Name **DACAVIN DR**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **OLD PROVIDENCE LN**
 Stop Condition-Street 2 **None**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	52.0	N/A	Ramp Length RT (in)	48.0
Yes	Ramp Width LT (in)	48.0	No	Ramp Width RT (in)	47.0
Yes	Ramp Slope LT (%)	5.8	Yes	Ramp Slope RT (%)	2.4
No	Ramp XSlope LT (%)	3.2	No	Ramp XSlope RT (%)	2.2
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	3.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.4	N/A	Clear Space?	N/A
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	20.7

