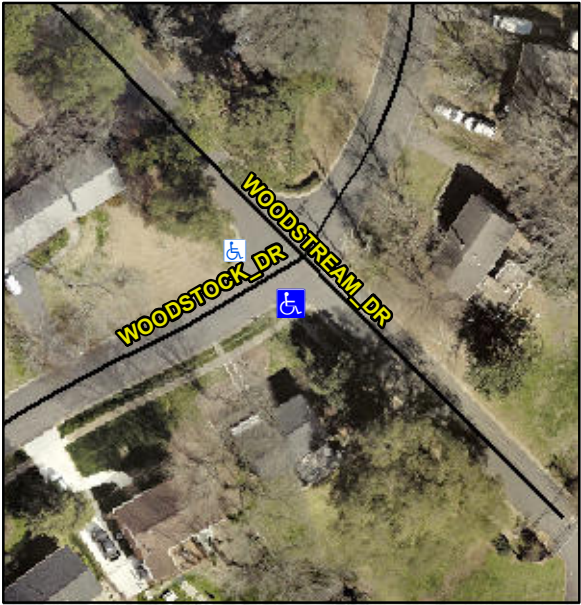


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 21535	Main Street: WOODSTOCK_DR	Cross Street: WOODSTREAM_DR	Location:	S
ADA ID: 67E8A97521D8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>					
	Surveyor Notes:	<b>N/A</b>					
	PROW/ADA:	<b>Not Found, R304.5.3</b>					
	Street 1 Name	<b>WOODSTREAM DR</b>					
	Stop Condition-Street 2	<b>None</b>					
	Street 2 Name	<b>WOODSTOCK DR</b>					
	Stop Condition-Street 1	<b>StopSign</b>					
	Total Cost:	<b>\$ 3200.00</b>					
				<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>
				<b>Description</b>			<b>Description</b>
				<b>Data</b>			<b>Data</b>
				<b>Yes</b>	<b>Ramp Length (in)</b>	<b>69.0</b>	<b>Yes</b>
				<b>No</b>	<b>Ramp Width (in)</b>	<b>48.0</b>	<b>No</b>
				<b>N/A</b>	<b>Flare Type LT</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Flare Slope LT (%)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Flare Traversable LT?</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Flare Traversable RT?</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Landing Length (in)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Landing Width (in)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Landing Slope (%)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Landing X Slope (%)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Landing Curb? (Y/N)</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Shared Landing?</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Gutter Ponding?</b>	<b>N/A</b>	<b>N/A</b>
				<b>N/A</b>	<b>Gutter Lip Ht (in)</b>	<b>N/A</b>	<b>N/A</b>
				<b>No</b>	<b>Painted X Walk1?</b>	<b>N/A</b>	<b>No</b>
				<b>To NE</b>	<b>X Walk 1 Direction</b>	<b>To NW</b>	<b>X Walk 2 Direction</b>
				<b>N/A</b>	<b>X Walk 1 Width (in)</b>	<b>N/A</b>	<b>N/A</b>
				<b>1.7</b>	<b>X Walk 1 Slope (%)</b>	<b>10.5</b>	<b>X Walk 2 Slope (%)</b>
				<b>11.3</b>	<b>X Walk 1 X Slope (%)</b>	<b>1.2</b>	<b>X Walk 2 X Slope (%)</b>
				<b>N/A</b>	<b>Ramp inside XWalk1?</b>	<b>N/A</b>	<b>Ramp inside XWalk2?</b>
				<b>8.9</b>	<b>Road Slope (%)</b>	<b>N/A</b>	<b>Clear Space?</b>
				<b>11.9</b>	<b>Road X Slope (%)</b>	<b>N/A</b>	<b>Clear Space to XWalk (in)</b>
				<b>N/A</b>	<b>Any Obstructions?</b>	<b>N/A</b>	<b>Storm Grate/Utility Hazard?</b>
					<b>Obstruction Type</b>		<b>Storm Grate/Utility Type</b>
				<b>N/A</b>		<b>N/A</b>	<b>N/A</b>
				<b>Yes</b>	<b>Surface Condition? (G/P)</b>	<b>Good</b>	

