


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10503	Main Street: N_GRAHAM_ST	Cross Street: PLYMOUTH_AV	Location: E
ADA ID: 68542448A4B0	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 17.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

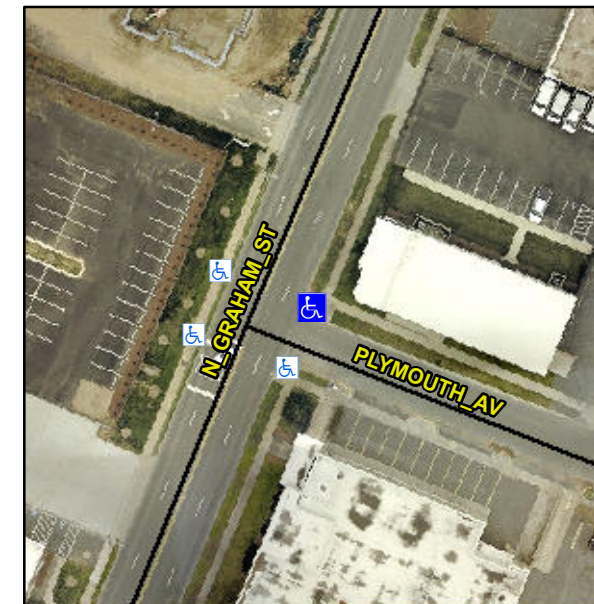

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, R305.1.4, R305.2, R302.7, R302.7.2

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	45.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.0	N/A	Flare Slope RT (%)	3.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	39.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.0
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	2.1
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	0.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7	N/A	Clear Space?	Yes
	Road X Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

