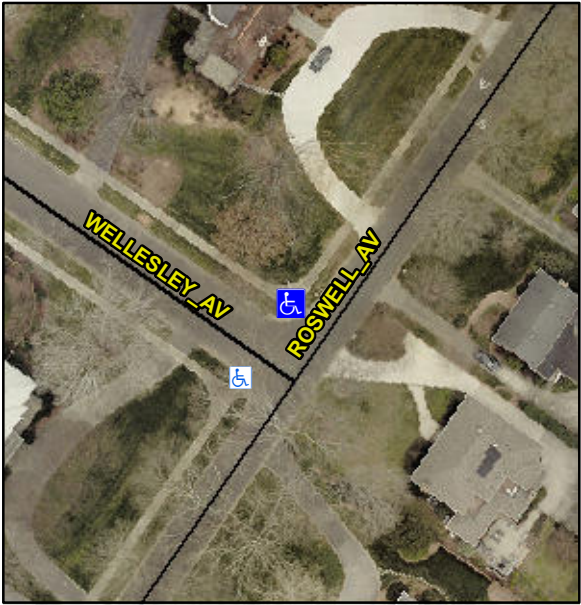


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 16787	Main Street: ROSWELL_AV	Cross Street: WELLESLEY_AV	Location: N
ADA ID: 6890C99287A7	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>				
	Surveyor Notes:				
	<b>N/A</b>				
	PROW/ADA:				
	<b>Not Found, R304.5.1, R304.2.2</b>				
	Street 1 Name	WELLESLEY AV		Stop Condition-Street 2	StopSign
	Street 2 Name	ROSWELL AV		Stop Condition-Street 1	None
	Total Cost:	\$	3200.00		
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	64.0	No
		No	Ramp Width (in)	46.0	Yes
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	N/A
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To SW	X Walk 2 Direction
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	0.8	X Walk 2 Slope (%)
			X Walk 1 X Slope (%)	4.3	X Walk 2 X Slope (%)
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	3.3	N/A
			Road X Slope (%)	3.8	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

