


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 54422	Main Street: LISMORE_LN	Cross Street: KILKENNY_DR	Location: N
ADA ID: 69079BFCD240	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 20
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

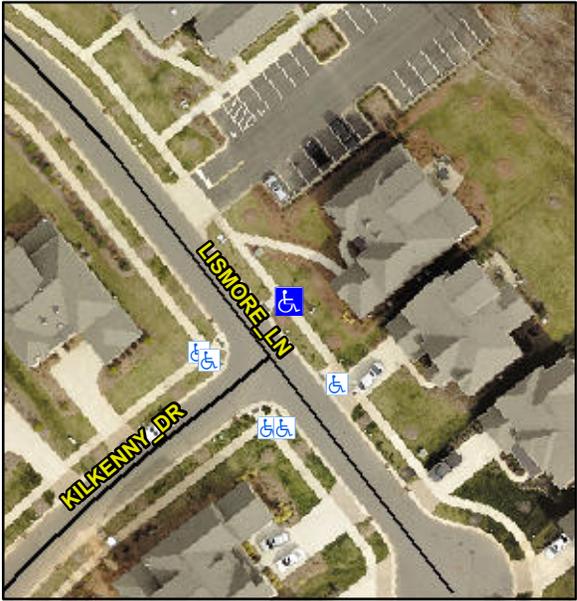

Possible Solutions:  
**Remove & Replace Gutter.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**R302.7.2, R304.5.4**

Street 1 Name	<b>LISMORE LN</b>
Stop Condition-Street 2	<b>None</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 1	<b>N/A</b>

Total Cost: \$ **750.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	1.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.3	N/A	Flare Slope RT (%)	7.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.2
No	Gutter Lip Ht (in)	3.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

