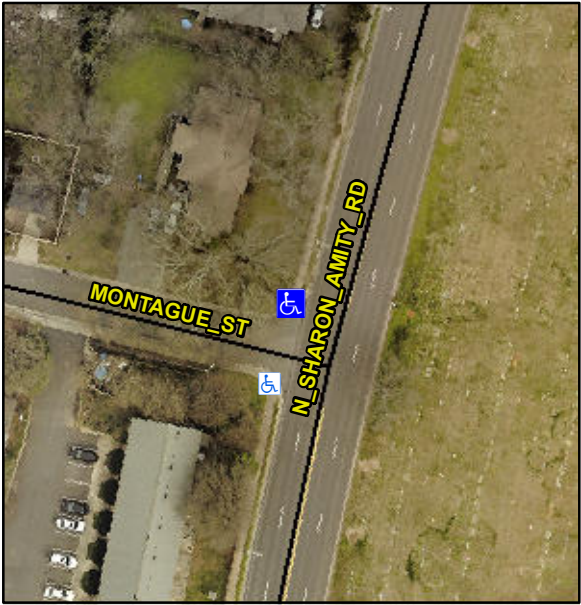


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 16944	Main Street: N_SHARON_AMITY_RD	Cross Street: MONTAGUE_ST	Location: NW
ADA ID: 6913277451F1	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	58.0	Yes	Ramp Slope (%)	5.9
		No	Ramp Width (in)	37.0	No	Ramp XSlope (%)	14.9
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To S		X Walk 2 Direction	To E
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	3.5
			X Walk 1 X Slope (%)	6.2		X Walk 2 X Slope (%)	0.1
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			Road Slope (%)	2.9	N/A	Clear Space?	N/A
			Road X Slope (%)	9.7	N/A	Clear Space to XWalk (in)	N/A
<p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
Total Cost:		\$	3200.00		N/A		N/A
					Yes	Surface Condition? (G/P)	Good

