

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 13383 Main Street: FORDHAM RD **Cross Street: WEST BV** Location: NE Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 694687394734 Ramp Type: ParaDiag Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



FORDHAM RD Street 1 Name Stop Condition-Street 1 StopSign **WEST BV** Street 2 Name Stop Condition-Street 2 None Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP <5%

PROW/ADA:

R304.5.1, R304.3.2

Total Cost:


Compliance Description Data Compliance Description Data N/A N/A Ramp Length LT (in) 56.0 Ramp Length RT (in) 84.0 No Yes Ramp Width LT (in) 61.0 Ramp Width RT (in) 46.5 No Ramp Slope LT (%) 8.5 Yes Ramp Slope RT (%) 1.7 Ramp XSlope LT (%) Yes Ramp XSlope RT (%) Yes 1.2 0.6 N/A Landing Length (in) N/A N/A DWS Provided? N/A N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A Landing Slope (%) N/A N/A DWS Length (in) N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A Shared Landing? N/A N/A N/A N/A Gutter Ponding? Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To SW X Walk 2 Direction To SE N/A X Walk 1 Width (in) N/A N/A X Walk 2 Width (in) N/A X Walk 1 Slope (%) 4.1 X Walk 2 Slope (%) 0.1 X Walk 1 X Slope (%) 0.7 X Walk 2 X Slope (%) 3.9 Ramp inside XWalk1? N/A N/A N/A Ramp inside XWalk2? N/A 3.6 N/A N/A Road Slope (%) Clear Space? Road X Slope (%) 3.2 N/A Clear Space to XWalk (in) N/A N/A N/A Any Obstructions? N/A Storm Grate/Utility Hazard? N/A Obstruction Type Storm Grate/Utility Type N/A N/A Yes Surface Condition? (G/P) Good

N/A

Curb Slope (%)

7.6



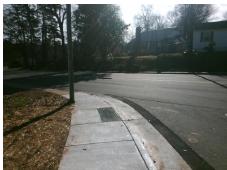



3200.00