


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7834	Main Street: BILMARK_AV	Cross Street: SNOW_WHITE_LN	Location: SE
ADA ID: 6966329B08B5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 14			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

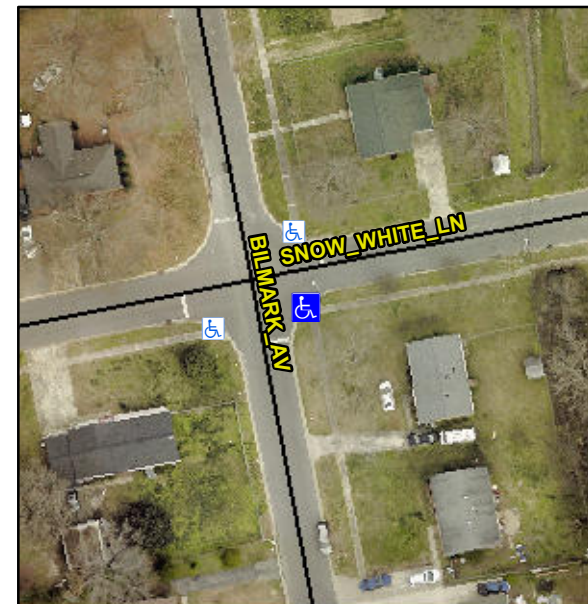

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7, R302.7.2

Street 1 Name **SNOW WHITE LN**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **BILMARK AV**
 Stop Condition-Street 1 **StopSign**

Total Cost: \$ **3400.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	32.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	75.5	Yes	Ramp XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.9	N/A	Flare Slope RT (%)	1.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	43.5	Yes	DWS Provided?	Yes
No	Landing Width (in)	33.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	6.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.4
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	4.3
	X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.6	N/A	Clear Space?	Yes
	Road X Slope (%)	5.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes	Yes	Surface Condition? (G/P)	Good

