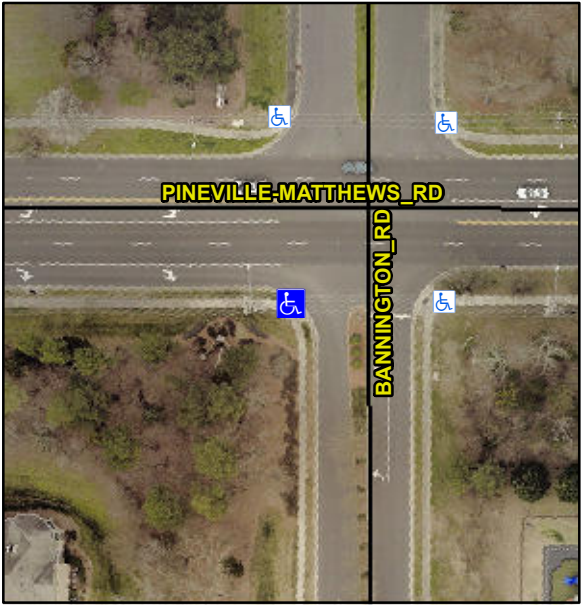


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 25823	Main Street: BANNINGTON_RD	Cross Street: PINEVILLE-MATTHEWS_RD	Location: SW
ADA ID: 69AE74F3919E	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 30	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>Yes</b>	Ramp Length (in)	96.0
			<b>No</b>	Ramp Width (in)	32.0
			<b>N/A</b>	Flare Type LT	N/A
			<b>N/A</b>	Flare Slope LT (%)	N/A
			<b>N/A</b>	Flare Traversable LT?	N/A
			<b>N/A</b>	Landing Length (in)	N/A
			<b>N/A</b>	Landing Width (in)	N/A
			<b>N/A</b>	Landing Slope (%)	N/A
			<b>N/A</b>	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p>			<b>N/A</b>	Landing Curb? (Y/N)	N/A
			<b>N/A</b>	Shared Landing?	N/A
			<b>N/A</b>	Gutter Ponding?	N/A
			<b>N/A</b>	Gutter Lip Ht (in)	N/A
			<b>No</b>	Painted X Walk1?	N/A
			<b>To E</b>	X Walk 1 Direction	To N
			<b>N/A</b>	X Walk 1 Width (in)	N/A
			<b>1.6</b>	X Walk 1 Slope (%)	7.1
			<b>6.3</b>	X Walk 1 X Slope (%)	1.3
			<b>N/A</b>	Ramp inside XWalk1?	N/A
<p>PROW/ADA:</p> <p><b>R304.5.1, R304.5.3</b></p>			<b>N/A</b>	Road Slope (%)	N/A
			<b>2.6</b>	Road X Slope (%)	N/A
			<b>N/A</b>	Any Obstructions?	N/A
				Obstruction Type	
			<b>N/A</b>		N/A
			<b>Yes</b>	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

