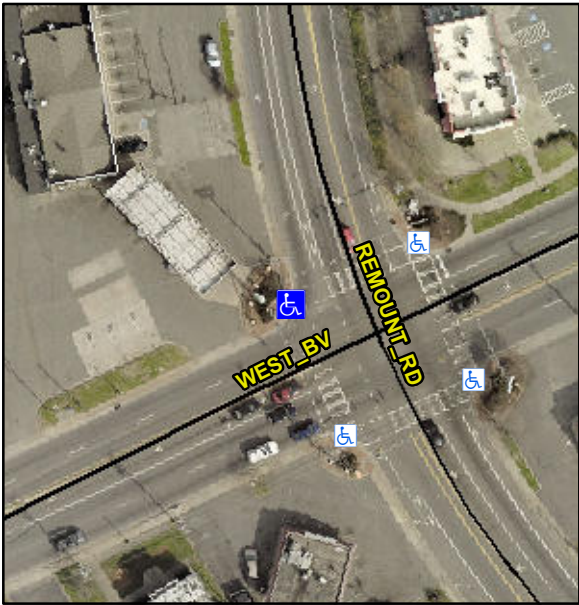


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13531	Main Street: REMOUNT_RD	Cross Street: WEST_BV	Location: NW
ADA ID: 69C55E76AF80	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	37.0	Yes	Ramp Slope (%)	6.8		
			Yes	Ramp Width (in)	57.0	No	Ramp XSlope (%)	4.0		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	4.5	No	Flare Slope RT (%)	11.6		
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes		
			Yes	Landing Length (in)	93.0	No	DWS Provided?	No		
			Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No		
			No	Landing Slope (%)	4.4	N/A	DWS Length (in)	N/A		
			Yes	Landing X Slope (%)	2.8	N/A	DWS Full Width?	No		
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.2.3, R305</p>				N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A	
				N/A	Shared Landing?	No				
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.3	
				Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.6	
				N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes	
					X Walk 1 Direction	To S		X Walk 2 Direction	To E	
				N/A	X Walk 1 Width (in)	107.0	N/A	X Walk 2 Width (in)	111.0	
					X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	2.1	
					X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	0.7	
				Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes	
				Road Slope (%)	2.8	N/A	Clear Space?	Yes		
				Road X Slope (%)	1.6	Yes	Clear Space to XWalk (in)	64.0		
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
				Obstruction Type			Storm Grate/Utility Type			
						N/A		N/A		
						Yes	Surface Condition? (G/P)	Good		
Total Cost:			\$	3200.00						

