

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53017	Main Street: STEEL_HOUSE_BV	Cross Street: CHARTRES_LN	Location: NW
ADA ID: 69D5B7296104	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

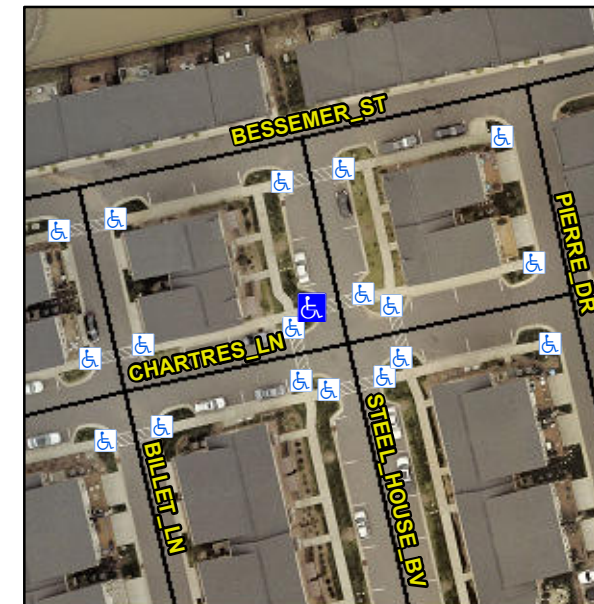

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	140.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	66.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	3.9	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	1.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	65.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.8	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	2.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	6.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.9
	X Walk 1 Direction	To E		Road X Slope (%)	3.0
	X Walk 1 Width (in)	67.5		Clear Space?	Yes
	X Walk 1 Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.7

