

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|--------------------------|-----------------------------|------------------------|
| Intersection ID: 19805 | Main Street: MORRISON_BV | Cross Street: SOUTH_PARK_DR | Location: NW |
| ADA ID: 69F2A9D43E0B | Ramp Type: ParaDiag | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | Severity Score: 0 | |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

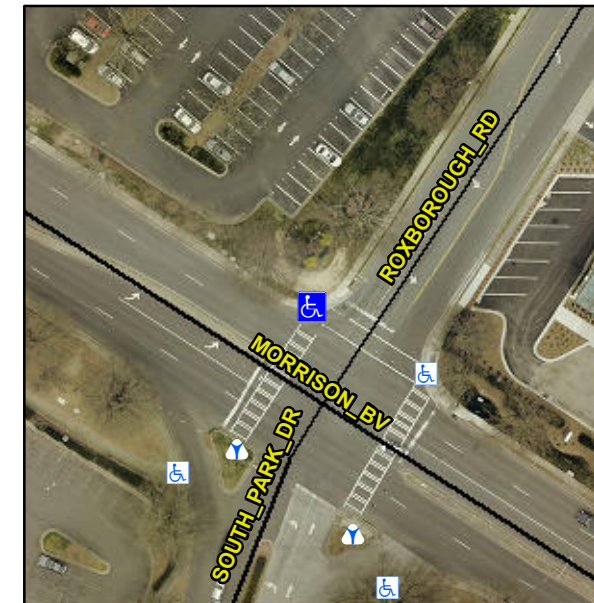

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.3

Total Cost:

\$ 2750.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|-------|
| N/A | Ramp Length LT (in) | 60.0 | N/A | Ramp Length RT (in) | 77.5 |
| Yes | Ramp Width LT (in) | 49.5 | Yes | Ramp Width RT (in) | 49.0 |
| Yes | Ramp Slope LT (%) | 1.6 | Yes | Ramp Slope RT (%) | 7.3 |
| Yes | Ramp XSlope LT (%) | 0.3 | Yes | Ramp XSlope RT (%) | 1.4 |
| Yes | Landing Length (in) | 48.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 60.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.3 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 1.5 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.0 |
| Yes | Gutter Lip Ht (in) | 0.0 | No | Gutter X Slope (%) | 2.7 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | Yes |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | To SE |
| N/A | X Walk 1 Width (in) | 111.0 | N/A | X Walk 2 Width (in) | 111.0 |
| | X Walk 1 Slope (%) | 0.6 | | X Walk 2 Slope (%) | 1.7 |
| | X Walk 1 X Slope (%) | 1.5 | | X Walk 2 X Slope (%) | 0.0 |
| Yes | Ramp inside XWalk1? | Yes | Yes | Ramp inside XWalk2? | Yes |
| | Road Slope (%) | 2.1 | N/A | Clear Space? | Yes |
| | Road X Slope (%) | 1.4 | Yes | Clear Space to XWalk (in) | 104.0 |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | Replace | Curb Slope (%) | 8.6 |

