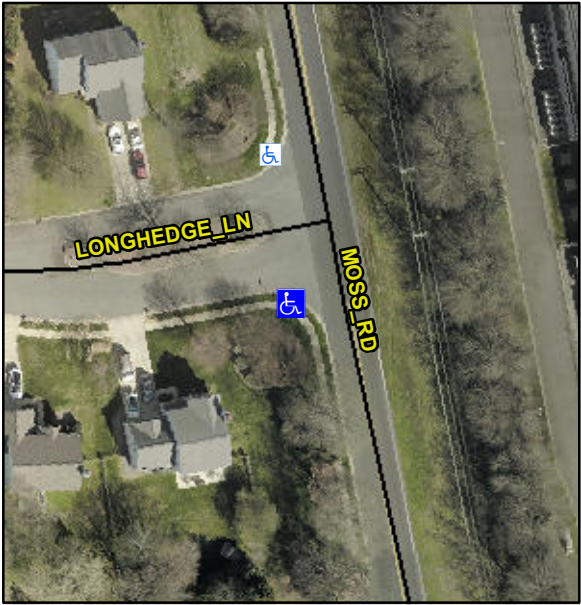


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                           |                                         |                        |
|-----------------------------------------|---------------------------|-----------------------------------------|------------------------|
| Intersection ID: 23898                  | Main Street: LONGHEDGE_LN | Cross Street: MOSS_RD                   | Location: SW           |
| ADA ID: 6A0ABD53C618                    | Ramp Type: PerpDiag       | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                           | Field Measurements/Component Compliance |                        |
| Severity Score: 12.5                    |                           |                                         |                        |

|                                                                                                         |                                                                          |            |                       |      |            |                             |      |
|---------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------|------------|-----------------------|------|------------|-----------------------------|------|
|                         | Possible Solutions:                                                      | Compliance | Description           | Data | Compliance | Description                 | Data |
|                                                                                                         | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. | N/A        | Ramp Length (in)      | 47.0 | No         | Ramp Slope (%)              | 8.6  |
|                                                                                                         |                                                                          | Yes        | Ramp Width (in)       | 48.0 | Yes        | Ramp XSlope (%)             | 0.9  |
|                                                                                                         |                                                                          | N/A        | Flare Type LT         | N/A  | N/A        | Flare Type RT               | N/A  |
|                                                                                                         |                                                                          | N/A        | Flare Slope LT (%)    | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
|                                                                                                         |                                                                          | N/A        | Flare Traversable LT? | N/A  | N/A        | Flare Traversable RT?       | N/A  |
|                                                                                                         |                                                                          | N/A        | Landing Length (in)   | N/A  | N/A        | DWS Provided?               | N/A  |
|                                                                                                         |                                                                          | N/A        | Landing Width (in)    | N/A  | N/A        | DWS Contrast?               | N/A  |
|                                                                                                         |                                                                          | N/A        | Landing Slope (%)     | N/A  | N/A        | DWS Length (in)             | N/A  |
|                                                                                                         |                                                                          | N/A        | Landing X Slope (%)   | N/A  | N/A        | DWS Full Width?             | N/A  |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2</p>                           |                                                                          | N/A        | Landing Curb? (Y/N)   | N/A  | N/A        | DWS Offset (in)             | N/A  |
|                                                                                                         |                                                                          | N/A        | Shared Landing?       | N/A  |            |                             |      |
|                                                                                                         |                                                                          | N/A        | Gutter Ponding?       | N/A  | N/A        | Gutter Slope (%)            | N/A  |
|                                                                                                         |                                                                          | N/A        | Gutter Lip Ht (in)    | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
|                                                                                                         |                                                                          | N/A        | Painted X Walk1?      | No   | N/A        | Painted X Walk2?            | No   |
|                                                                                                         |                                                                          |            | X Walk 1 Direction    | To E |            | X Walk 2 Direction          | To N |
|                                                                                                         |                                                                          | N/A        | X Walk 1 Width (in)   | N/A  | N/A        | X Walk 2 Width (in)         | N/A  |
|                                                                                                         |                                                                          |            | X Walk 1 Slope (%)    | 2.0  |            | X Walk 2 Slope (%)          | 2.8  |
|                                                                                                         |                                                                          |            | X Walk 1 X Slope (%)  | 2.9  |            | X Walk 2 X Slope (%)        | 1.3  |
|                                                                                                         |                                                                          | N/A        | Ramp inside XWalk1?   | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
| <p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p> |                                                                          |            | Road Slope (%)        | 0.6  | N/A        | Clear Space?                | N/A  |
|                                                                                                         |                                                                          |            | Road X Slope (%)      | 3.4  | N/A        | Clear Space to XWalk (in)   | N/A  |
|                                                                                                         |                                                                          | N/A        | Any Obstructions?     | N/A  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|                                                                                                         |                                                                          |            | Obstruction Type      |      |            | Storm Grate/Utility Type    |      |
|                                                                                                         |                                                                          |            |                       |      | N/A        |                             | N/A  |
|                                                                                                         |                                                                          |            |                       |      | Yes        | Surface Condition? (G/P)    | Good |
|                                                                                                         |                                                                          |            |                       |      |            |                             |      |
|                                                                                                         |                                                                          |            |                       |      |            |                             |      |
|                                                                                                         |                                                                          |            |                       |      |            |                             |      |
|                                                                                                         |                                                                          |            |                       |      |            |                             |      |
| Total Cost:                                                                                             |                                                                          | \$         | 3200.00               |      |            |                             |      |

