


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 28310	Main Street: ARDREY_KELL_RD	Cross Street: WADE_ARDREY_RD	Location: NW
ADA ID: 6A0BE7922919	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 7.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

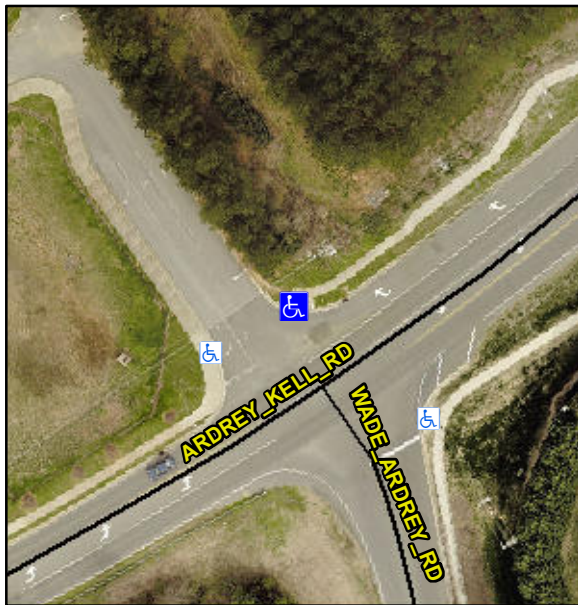

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.1.4, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	58.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	9.5	Yes	Flare Slope RT (%)	5.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	0.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	2.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.4	N/A	Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3950.00

