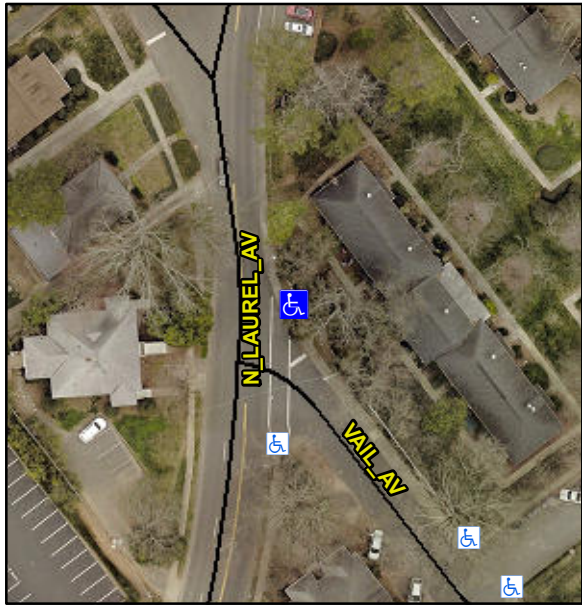


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14840	Main Street: N_LAUREL_AV	Cross Street: VAIL_AV	Location: NE
ADA ID: 6AA2A4C6CEF1	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length LT (in)	68.0	N/A	Ramp Length RT (in)	72.0
			Yes	Ramp Width LT (in)	55.0	Yes	Ramp Width RT (in)	54.0
			Yes	Ramp Slope LT (%)	2.9	No	Ramp Slope RT (%)	9.5
			Yes	Ramp XSlope LT (%)	0.0	No	Ramp XSlope RT (%)	2.3
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:			N/A	Shared Landing?	N/A			
LT RP < 5%			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
PROW/ADA:			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
R304.3.2, R304.5.3			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
				X Walk 1 Direction	To W		X Walk 2 Direction	To S
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	125.0
				X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	7.6
				X Walk 1 X Slope (%)	5.3		X Walk 2 X Slope (%)	2.1
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes
				Road Slope (%)	1.1	N/A	Clear Space?	N/A
				Road X Slope (%)	7.4	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
Total Cost:		\$ 3200.00			N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	4.9

Street 1 Name	N LAUREL AV
Stop Condition-Street 1	None
Street 2 Name	VAIL AV
Stop Condition-Street 2	StopSign

