


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 15127 Main Street: EXECUTIVE\_CR Cross Street: REGAL\_OAKS\_DR Location: SW **Overall Compliance: No** ADA ID: 6ADD723B33B6 Ramp Type: Perp Initial Pass/Fail: Fail Severity Score: 21.25

**Codes/Mitigation Info/Possible Solution** 


Total Cost:

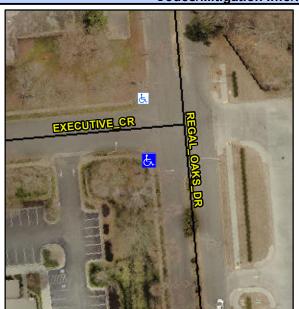

**EXECUTIVE CR** Street 1 Name Stop Condition-Street 2 StopSign Street 2 Name N/A Stop Condition-Street 1 N/A

| Possible Solutions:           |  |  |  |  |  |  |
|-------------------------------|--|--|--|--|--|--|
| Remove & Replace Entire Ramp. |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
| Surveyor Notes:               |  |  |  |  |  |  |
| N/A                           |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
| PROW/ADA:                     |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
| Not Found, R304.5.1, R304.2.2 |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |
|                               |  |  |  |  |  |  |



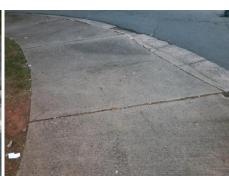

1850.00

| Field Measurements/Component Compliance |                       |       |      |        |                         |      |  |
|---|-----------------------|-------|------|--------|-------------------------|------|--|
| Compliance Description                  |                       | Data  | Comp | liance | Description             | Data |  |
| N/A                                     | Ramp Length (in)      | 102.0 | No   | Ramp   | Slope (%)               | 8.4  |  |
| No                                      | Ramp Width (in)       | 40.0  | Yes  | Ramp   | XSlope (%)              | 1.6  |  |
| N/A                                     | Flare Type LT         | N/A   | N/A  | Flare  | Type RT                 | N/A  |  |
| N/A                                     | Flare Slope LT (%)    | N/A   | N/A  | Flare  | Slope RT (%)            | N/A  |  |
| N/A                                     | Flare Traversable LT? | N/A   | N/A  | Flare  | Traversable RT?         | N/A  |  |
| N/A                                     | Landing Length (in)   | N/A   | N/A  | DWS    | Provided?               | N/A  |  |
| N/A                                     | Landing Width (in)    | N/A   | N/A  | DWS    | Contrast?               | N/A  |  |
| N/A                                     | Landing Slope (%)     | N/A   | N/A  | DWS    | Length (in)             | N/A  |  |
| N/A                                     | Landing X Slope (%)   | N/A   | N/A  | DWS    | Full Width?             | N/A  |  |
| N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A  | DWS    | Offset (in)             | N/A  |  |
| N/A                                     | Shared Landing?       | N/A   |      |        |                         |      |  |
| N/A                                     | Gutter Ponding?       | N/A   | N/A  | Gutte  | r Slope (%)             | N/A  |  |
| N/A                                     | Gutter Lip Ht (in)    | N/A   | N/A  | Gutte  | r X Slope (%)           | N/A  |  |
| N/A                                     | Painted X Walk1?      | No    | N/A  | Paint  | ed X Walk2?             | N/A  |  |
|   | X Walk 1 Direction    | To N  |      | X Wa   | lk 2 Direction          | N/A  |  |
| N/A                                     | X Walk 1 Width (in)   | N/A   | N/A  | X Wa   | lk 2 Width (in)         | N/A  |  |
|   | X Walk 1 Slope (%)    | 3.9   |      | X Wa   | lk 2 Slope (%)          | N/A  |  |
|   | X Walk 1 X Slope (%)  | 2.8   |      | X Wa   | lk 2 X Slope (%)        | N/A  |  |
| N/A                                     | Ramp inside XWalk1?   | N/A   | N/A  | Ram    | inside XWalk2?          | N/A  |  |
|   | Road Slope (%)        | N/A   | N/A  | Clear  | Space?                  | N/A  |  |
|   | Road X Slope (%)      | N/A   | N/A  | Clear  | Space to XWalk (in)     | N/A  |  |
| N/A                                     | Any Obstructions?     | N/A   | N/A  | Storn  | n Grate/Utility Hazard? | N/A  |  |
|   | Obstruction Type      |       |      | Storn  | n Grate/Utility Type    |      |  |
|   |                       | N/A   |      |        |                         | N/A  |  |
|   |                       |       | Yes  | Surfa  | ce Condition? (G/P)     | Good |  |