


Intersection ID: 10031994	Main Street: MONROE_RD	Cross Street: N/A	Location:	NE
ADA ID: 6B52D85F3DF3	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

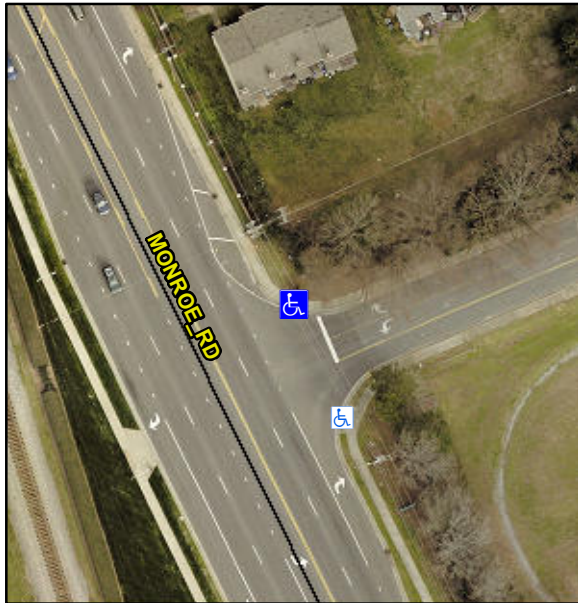

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.3.2, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	59.0	N/A	Ramp Length RT (in)	69.0
Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	59.0
No	Ramp Slope LT (%)	9.7	Yes	Ramp Slope RT (%)	4.7
No	Ramp XSlope LT (%)	4.4	No	Ramp XSlope RT (%)	2.8
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	1.3
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	1.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.1	N/A	Clear Space?	N/A
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.5

**Total Cost: \$ 3200.00**

**N/A**

**N/A**

<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
------------	--------------------------	-------------

N/A	Curb Slope (%)	7.5
-----	----------------	-----

Street 1 Name	MONROE RD
Stop Condition-Street 1	None
Street 2 Name	ENTRANCE
Stop Condition-Street 2	StopSign

