


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                         |                                         |                        |
|-----------------------------------------|-------------------------|-----------------------------------------|------------------------|
| Intersection ID: 15916                  | Main Street: BRANDON_RD | Cross Street: PEMBROKE_AV               | Location: SW           |
| ADA ID: 6B58E8C03E2C                    | Ramp Type: PerpDiag     | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 5                       |                         |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                         | Field Measurements/Component Compliance |                        |

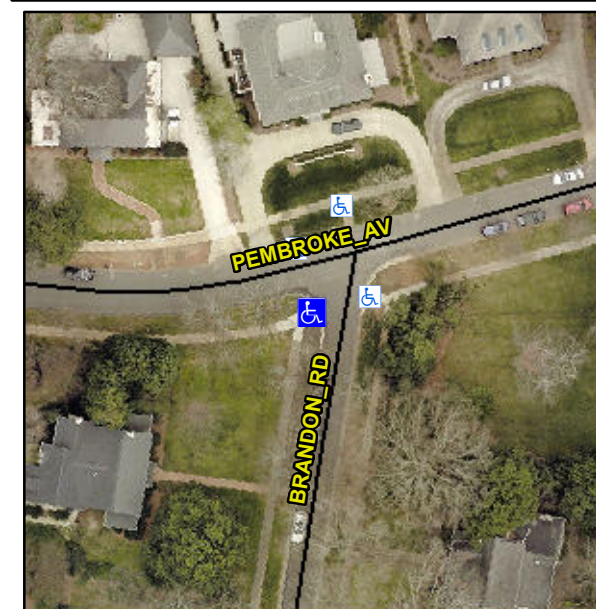

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.3, R304.5.3**

Total Cost: \$ 3950.00

| Compliance | Description           | Data                   | Compliance | Description                 | Data |
|------------|-----------------------|------------------------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 91.0                   | Yes        | Ramp Slope (%)              | 6.0  |
| Yes        | Ramp Width (in)       | 58.0                   | Yes        | Ramp XSlope (%)             | 1.8  |
| No         | Flare Type            | Curbed_WithWalkSurface | No         | Flare Type RT               | N/A  |
| No         | Flare Slope LT (%)    | N/A                    | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | No                     | N/A        | Flare Traversable RT?       | No   |
| Yes        | Landing Length (in)   | 48.0                   | Yes        | DWS Provided?               | Yes  |
| Yes        | Landing Width (in)    | 58.0                   | Yes        | DWS Contrast?               | Yes  |
| Yes        | Landing Slope (%)     | 0.7                    | Yes        | DWS Length (in)             | 24.0 |
| Yes        | Landing X Slope (%)   | 0.3                    | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)   | No                     | Yes        | DWS Offset (in)             | 0.0  |
| N/A        | Shared Landing?       | No                     |            |                             |      |
| Yes        | Gutter Ponding?       | No                     | Yes        | Gutter Slope (%)            | 1.7  |
| Yes        | Gutter Lip Ht (in)    | 0.0                    | No         | Gutter X Slope (%)          | 5.5  |
| N/A        | Painted X Walk1?      | No                     | N/A        | Painted X Walk2?            | No   |
|            | X Walk 1 Direction    | To E                   |            | X Walk 2 Direction          | To N |
| N/A        | X Walk 1 Width (in)   | N/A                    | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 4.8                    |            | X Walk 2 Slope (%)          | 0.3  |
|            | X Walk 1 X Slope (%)  | 2.1                    |            | X Walk 2 X Slope (%)        | 5.5  |
| N/A        | Ramp inside XWalk1?   | N/A                    | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 5.4                    | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)      | 4.2                    | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?     | No                     | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type      |                        |            | Storm Grate/Utility Type    |      |
|            |                       | N/A                    |            |                             | N/A  |
|            |                       |                        | Yes        | Surface Condition? (G/P)    | Good |

Street 1 Name BRANDON RD  
 Stop Condition-Street 2 StopSign  
 Street 2 Name PEMBROKE AV  
 Stop Condition-Street 1 None

