


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10040992	Main Street: WALTON_RD	Cross Street: CHELVESTON_DR	Location: E
ADA ID: 6BEB89E7D8B2	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 0.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

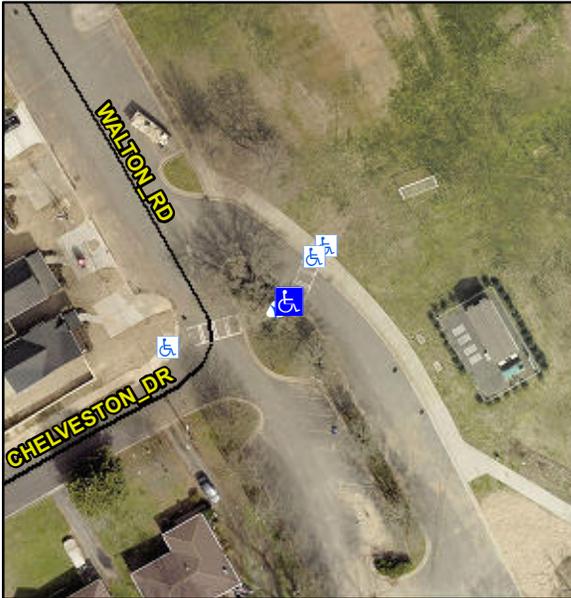

Possible Solutions:
Remove & Replace Landing.
Remove & Replace Gutter.

Surveyor Notes:
LOCATED ON ISLAND

PROW/ADA:
**R304.2.2-Perp, R304.3.2-Para,
 R304.5.3**

Street 1 Name	WALTON RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ **1250.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	177.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	70.0	Yes	Grade Break Slope (%)	4.1
Yes	Ramp Slope (%)	3.8	Yes	Grade Break XSlope (%)	2.9
Yes	Ramp XSlope (%)	2.9			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	55.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.2	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	36.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.4
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.4
	X Walk 1 Direction	To N		Road X Slope (%)	3.3
	X Walk 1 Width (in)	97.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.3	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.5

