

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 23574	Main Street: CARMEL_RD	Cross Street: QUAIL_HOLLOW_RD	Location: SW
ADA ID: 6C46887FEB54	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

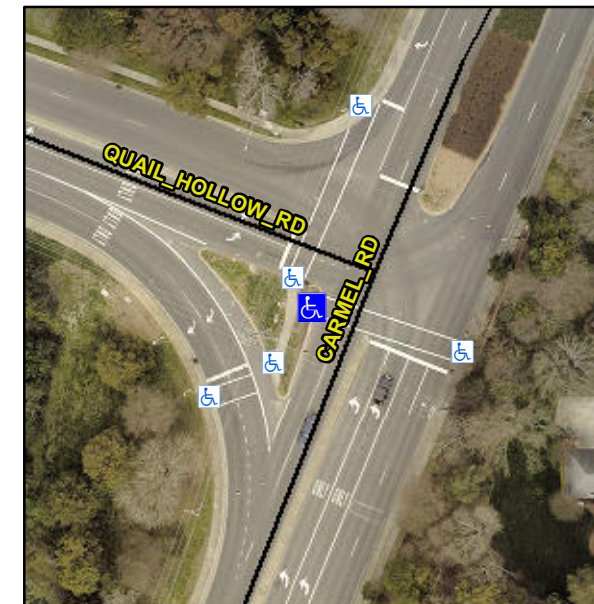

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

DAMAGED GTR

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	101.0	Yes	BlendTrans Slope (%)	2.2
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.7
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	77.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	120.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	4.8

Street 1 Name	CARMEL RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

