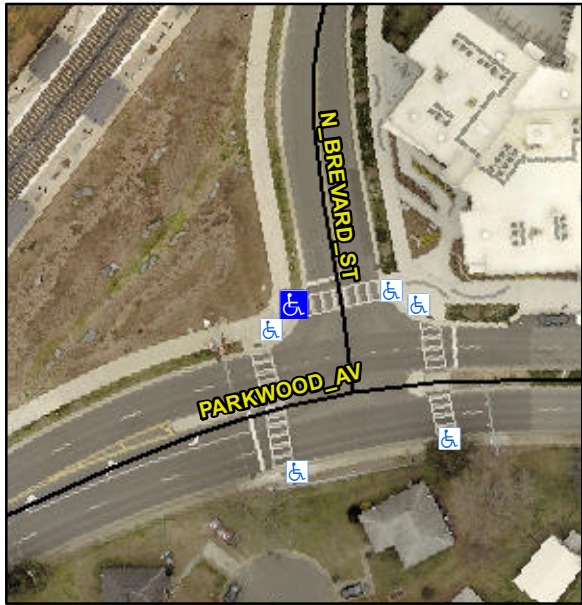


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11208	Main Street: PARKWOOD_AV	Cross Street: N_BREVARD_ST	Location: NW
ADA ID: 6D28F53DDC87	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Landing.		N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	7.0
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.0
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	7.8	Yes	Flare Slope RT (%)	3.6
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	2.4	Yes	DWS Full Width?	Yes
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3</p>			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.6
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.8
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	116.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
			Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	500.00					

