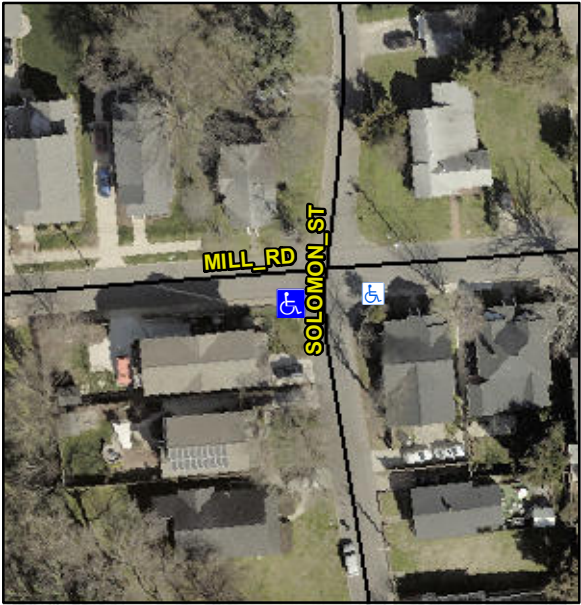


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10116	Main Street: MILL_RD	Cross Street: SOLOMON_ST	Location: SW
ADA ID: 6D59E433A51C	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 55	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	34.0	No
			No	Ramp Width (in)	35.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To E	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	5.4	N/A
				X Walk 1 X Slope (%)	2.4	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>			N/A	Road Slope (%)	N/A	N/A
			N/A	Road X Slope (%)	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
					N/A	N/A
			Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 1850.00				

Street 1 Name	SOLOMON ST
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

