


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52610		Main Street: LEGRANGER_RD		Cross Street: HERITAGE_POND_DR		Location: SW													
ADA ID: 6D9725A4BAF9		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75											
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance															
<div></div> <div>Street 1 NameLEGRANGER RD</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		55.0		N/A		Grade Break?		N/A		N/A	
				Surveyor Notes: N/A		Yes		Ramp Width (in)		63.5		N/A		Grade Break Slope (%)		0.0		N/A	
						No		Ramp Slope (%)		10.2		N/A		Grade Break XSlope (%)		0.0		N/A	
						Yes		Ramp XSlope (%)		4.1									
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0		N/A	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A		N/A	
						N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A		N/A	
						N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A		N/A	
						N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A		N/A	
						N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A		N/A	
				PROW/ADA: R304.2.2		N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A		N/A	
						N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A		N/A	
						N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A		N/A	
						N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A		N/A	
						N/A		Painted X Walk1?		No				Road Slope (%)		1.8		N/A	
								X Walk 1 Direction		To E				Road X Slope (%)		5.7		N/A	
								X Walk 1 Width (in)		N/A				Clear Space?		N/A		N/A	
								X Walk 1 Slope (%)		1.8		N/A		Clear Space to XWalk (in)		N/A		N/A	
								X Walk 1 X Slope (%)		5.7		N/A		Storm Grate/Utility Hazard?		N/A		N/A	
						N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type					
						Any Obstructions?		N/A						N/A		N/A			
						Obstruction Type				Yes		Surface Condition? (G/P)		Good					
										N/A		N/A		Curb Slope (%)		N/A			
				Total Cost:				\$		1600.00									

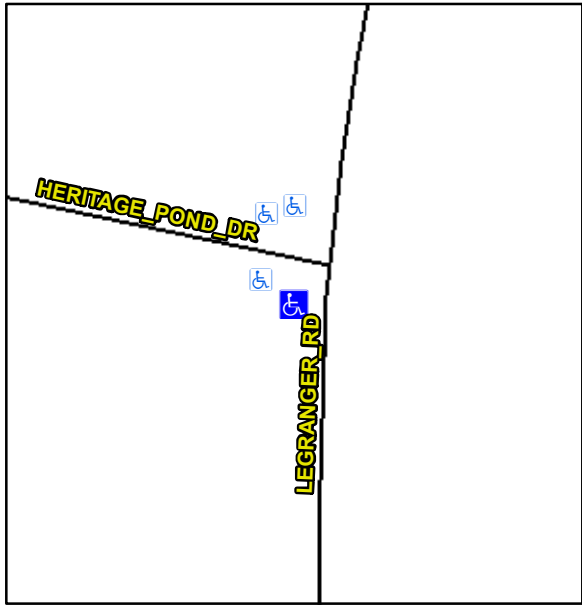