


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 19024	Main Street: CAVENDISH_CT	Cross Street: PROVIDENCE_RD	Location: NW
ADA ID: 6DA9E987C23F	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 31.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

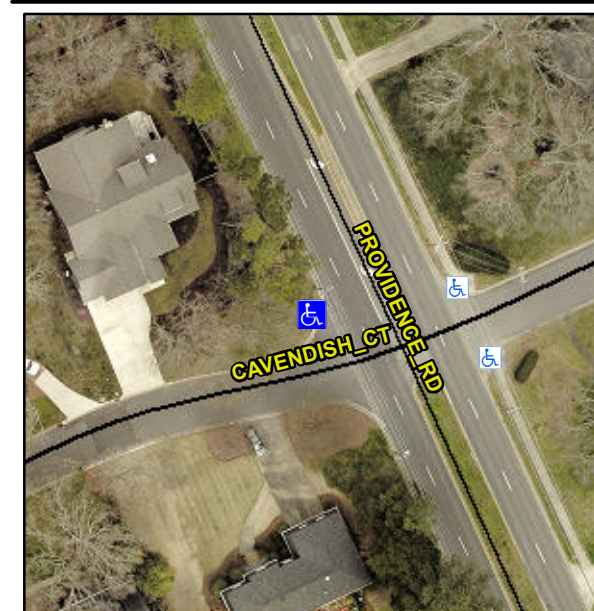

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

MEDIAN ACROSS PROVIDENCE RD

PROW/ADA:

R304.5.1, R304.5.3, R304.3.2

Street 1 Name	CAVENDISH CT
Stop Condition-Street 1	StopSign
Street 2 Name	PROVIDENCE RD
Stop Condition-Street 2	None

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	57.0	N/A	Ramp Length RT (in)	54.0
No	Ramp Width LT (in)	33.5	No	Ramp Width RT (in)	34.0
Yes	Ramp Slope LT (%)	3.9	No	Ramp Slope RT (%)	11.6
No	Ramp XSlope LT (%)	2.7	No	Ramp XSlope RT (%)	3.1
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	11.8
	X Walk 1 X Slope (%)	11.8		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	7.3	N/A	Clear Space?	N/A
	Road X Slope (%)	9.3	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.8

