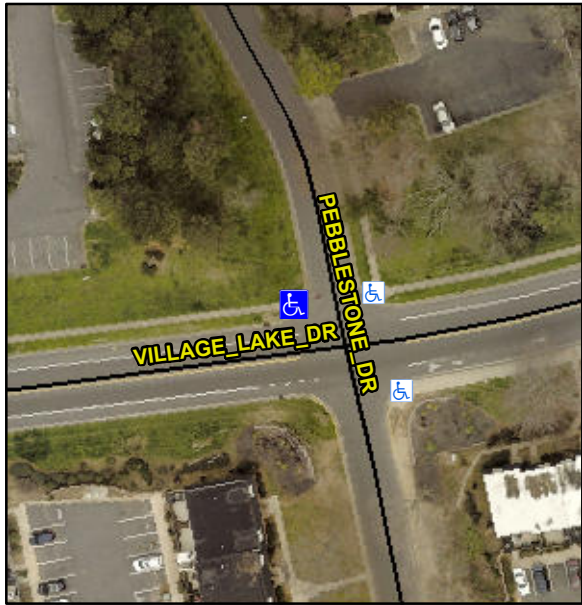


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 19259	Main Street: PEBBLESTONE_DR	Cross Street: VILLAGE_LAKE_DR	Location: NW
ADA ID: 6DB03D09EE27	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance						
	Possible Solutions:	<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>	N/A	Ramp Length (in)	39.0	No	Ramp Slope (%)	9.5	
		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.1	
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
Surveyor Notes:	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To S		X Walk 2 Direction	To E	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	2.8	
			X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	2.6	
	PROW/ADA:	Not Found, R304.2.2, R304.5.3	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	2.5	N/A	Clear Space?	N/A	
			Road X Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A	
N/A			Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:			\$	3200.00				

Total Cost: \$ 3200.00

