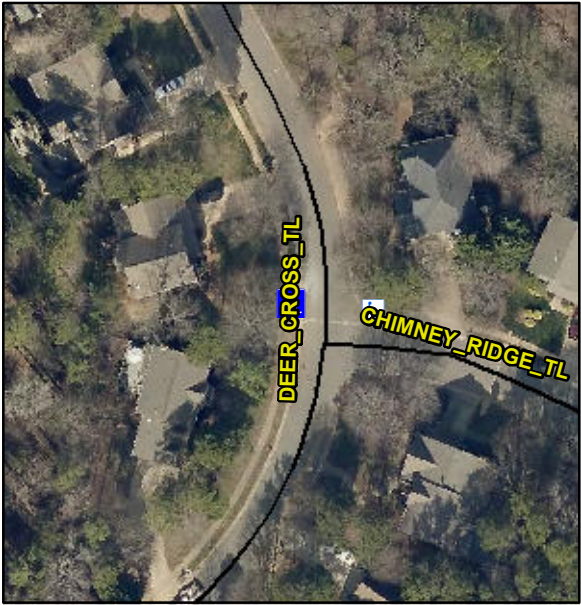


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3840	Main Street: CHIMNEY RIDGE TL	Cross Street: DEER CROSS TL	Location:	NW
ADA ID: 6E20DCDA5521	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Slope (%)	6.1
			No	Ramp XSlope (%)	3.9
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	N/A
			N/A	X Walk 1 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	N/A
			N/A	X Walk 1 X Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 1850.00</p>			No	Painted X Walk2?	N/A
			To E	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			5.2	X Walk 2 Slope (%)	N/A
			3.4	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			N/A	Surface Condition? (G/P)	Good
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		

