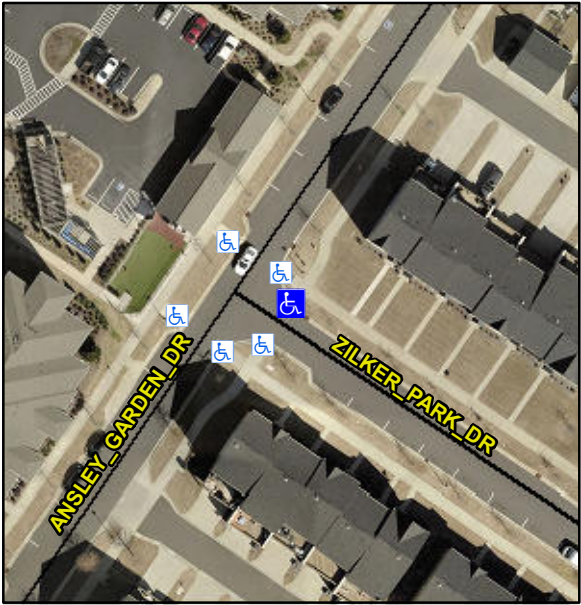


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: ANSLEY GARDEN DR	Cross Street: ZILKER PARK DR	Location: E
ADA ID: 6E9529A34FC6	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 1.25			

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes: N/A	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	69.0	N/A	Grade Break?	N/A
		Yes	Ramp Width (in)	71.0	N/A	Grade Break Slope (%)	0.0
		Yes	Ramp Slope (%)	4.4	N/A	Grade Break XSlope (%)	0.0
		No	Ramp XSlope (%)	2.1			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
	PROW/ADA: R304.5.3	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	1.3
			X Walk 1 Direction	To SW		Road X Slope (%)	2.6
			X Walk 1 Width (in)	N/A		Clear Space?	N/A
			X Walk 1 Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
			X Walk 1 X Slope (%)	2.6	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	Ramp inside XWalk1?	No		Storm Grate/Utility Type	
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	10.4
	Total Cost:	\$	1600.00				

