


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 2491 Main Street: LYNNEWOOD GLEN DR **Cross Street: MCCHESNEY DR** Location: **Overall Compliance: No ADA ID: 6EB5E6DAE134** Ramp Type: PerpDiag Initial Pass/Fail: Fail Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

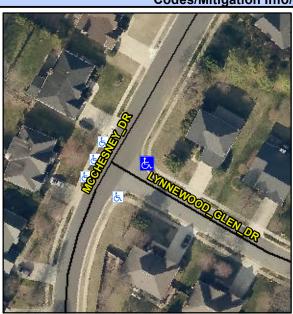

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1

MCCHESNEY DR None LYNNEWOOD GLEN DR StopSign Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3

Total Cost: 3200.00 Compliance Description <u>Data</u> Compliance Description Data No N/A Ramp Length (in) 49.0 Ramp Slope (%) 9.4 No Yes Ramp Width (in) 48.0 Ramp XSlope (%) 2.3 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A Landing Slope (%) N/A DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To NW X Walk 2 Direction To SW N/A N/A X Walk 1 Width (in) N/A X Walk 2 Width (in) N/A X Walk 1 Slope (%) 5.7 X Walk 2 Slope (%) 1.9 X Walk 2 X Slope (%) X Walk 1 X Slope (%) 0.4 1.9 N/A N/A N/A Ramp inside XWalk2? N/A Ramp inside XWalk1? Road Slope (%) 0.9 N/A Clear Space? N/A N/A Road X Slope (%) Clear Space to XWalk (in) N/A 1.9 N/A N/A N/A Any Obstructions? Storm Grate/Utility Hazard? N/A **Obstruction Type**

N/A

Yes

Storm Grate/Utility Type

Surface Condition? (G/P)

N/A

Good





