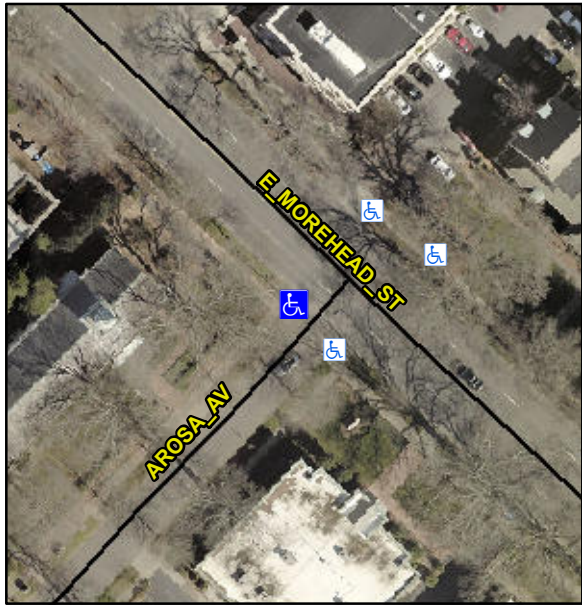


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14226	Main Street: AROSA_AV	Cross Street: E_MOREHEAD_ST	Location: W
ADA ID: 6F155F89B7DA	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Detectable Warning System. Remove & Replace Gutter.		N/A	Ramp Length (in)	108.0	Yes	Ramp Slope (%)	7.0
			Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	1.6
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	8.1	N/A	Flare Slope RT (%)	3.3
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
			Yes	Landing X Slope (%)	0.9	No	DWS Full Width?	No
Surveyor Notes: N/A PROW/ADA: R305.1.4, R305.2, R302.7, R304.5.4			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	10.0
			N/A	Shared Landing?	No			
			No	Gutter Ponding?	Yes	No	Gutter Slope (%)	7.1
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	2.9
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	2.6
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.1	N/A	Clear Space?	Yes	
			Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

Street 1 Name	AROSA AV
Stop Condition-Street 2	StopSign
Street 2 Name	E MOREHEAD ST
Stop Condition-Street 1	None

