


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 27610	Main Street: JOHNSTON_RD	Cross Street: JOHN_J_DELANEY_DR	Location: SW
ADA ID: 6F309E6CA4F4	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 10			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

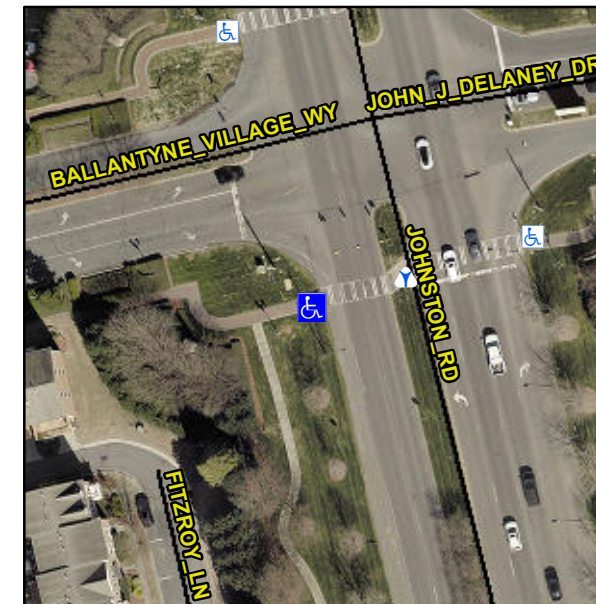

Possible Solutions:

**Install Detectable Warning System.**

Surveyor Notes:

**NO CURB**

PROW/ADA:

**R305**

Total Cost: \$ 235.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	60.0	Yes	BlendTrans XSlope (%)	0.9
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	108.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9		Clear Space?	Yes
	Road X Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.8

