


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10027514	Main Street: GRANDIN_RD	Cross Street: N/A	Location: NW
ADA ID: 700A806DEE5C	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 22.75			

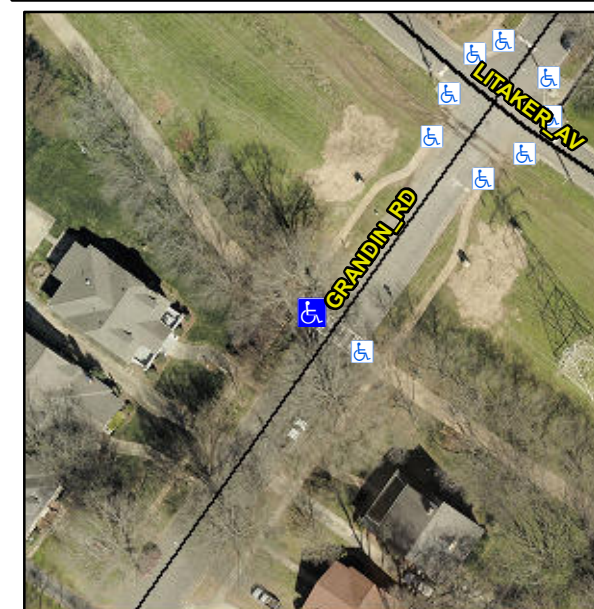

Possible Solutions:

**Install Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:

NO CURB

PROW/ADA:

**R305, R302.7, R302.7.2, R304.5.4,
R304.5.3**

Total Cost: \$ 985.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	123.0	Yes	BlendTrans Slope (%)	5.0
Yes	Ramp Width (in)	120.0	Yes	BlendTrans XSlope (%)	3.0
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	119.0	No	DWS Provided?	No
Yes	Landing Width (in)	120.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	2.0	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.6	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	Yes			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.2
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0		Clear Space?	Yes
	Road X Slope (%)	5.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name	GRANDIN RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

