


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10029213	Main Street: JOHN_PRICE_RD	Cross Street: N/A	Location: SE
ADA ID: 70CDF0D11CF5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 12.75			

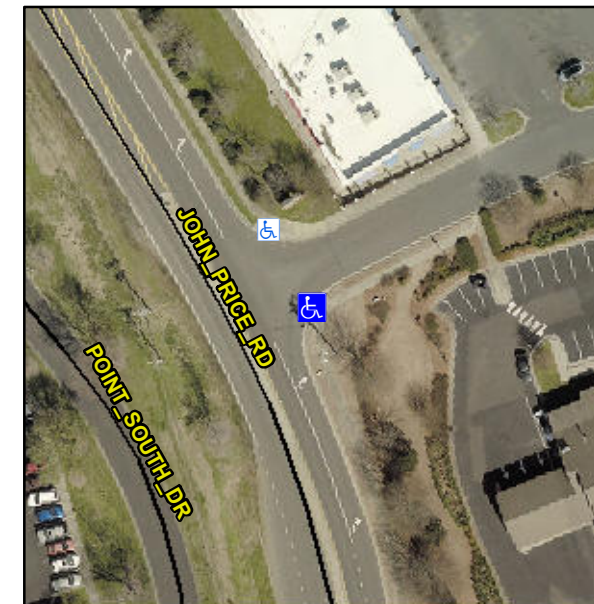

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.7	Yes	Flare Slope RT (%)	9.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	No	DWS Length (in)	23.5
No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	2.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2	N/A	Clear Space?	Yes
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

Street 1 Name **ENTRANCE**

Stop Condition-Street 2 **StopSign**

Street 2 Name **JOHN PRICE RD**

Stop Condition-Street 1 **None**

