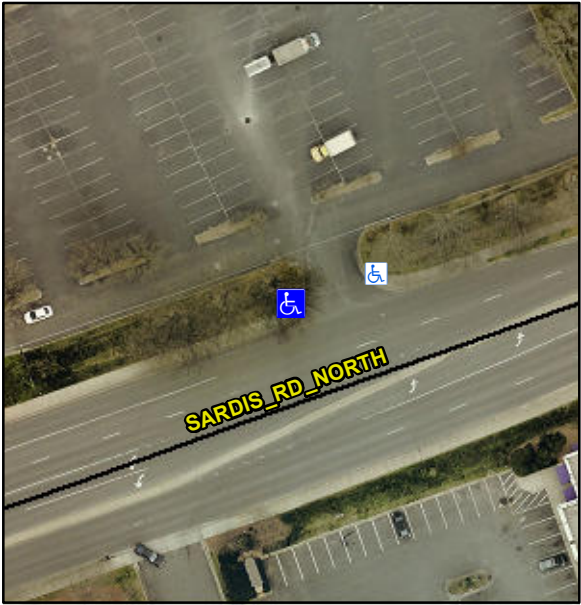


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10037285	Main Street: SARDIS_RD_NORTH	Cross Street: N/A	Location: NW
ADA ID: 70FE99670DDB	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length LT (in)	<b>45.0</b>
			<b>Yes</b>	Ramp Width LT (in)	<b>72.0</b>
			<b>No</b>	Ramp Slope LT (%)	<b>10.5</b>
			<b>Yes</b>	Ramp XSlope LT (%)	<b>1.0</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>RT RP &lt; 5%</b></p> <p>PROW/ADA:</p> <p><b>R304.3.2</b></p>			<b>N/A</b>	Shared Landing?	<b>N/A</b>
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>No</b>
				X Walk 1 Direction	<b>To NE</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
				X Walk 1 Slope (%)	<b>0.3</b>
				X Walk 1 X Slope (%)	<b>1.9</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>
				Road Slope (%)	<b>N/A</b>
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>	<b>ENTRANCE</b>		<b>N/A</b>	Road X Slope (%)	<b>N/A</b>
	<b>StopSign</b>		<b>N/A</b>	Any Obstructions?	<b>N/A</b>
	<b>N/A</b>			Obstruction Type	
	<b>N/A</b>				
Total Cost:		<b>\$ 1600.00</b>	<b>N/A</b>		<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
			<b>N/A</b>	Curb Slope (%)	<b>10.9</b>

