


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27847	Main Street: PARADISE RIDGE RD	Cross Street: NORTH COMMUNITY HOUSE RD	Location: NE
ADA ID: 710BC0173651	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

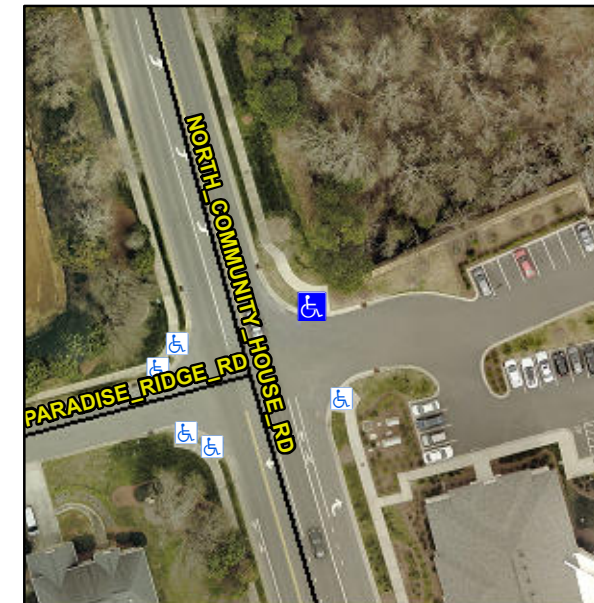

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	28.0	N/A	Ramp Length RT (in)	50.0
Yes	Ramp Width LT (in)	167.0	Yes	Ramp Width RT (in)	167.0
Yes	Ramp Slope LT (%)	0.1	No	Ramp Slope RT (%)	11.1
Yes	Ramp XSlope LT (%)	1.9	No	Ramp XSlope RT (%)	2.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	1.5
	X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	4.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.3	N/A	Clear Space?	N/A
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.1

Street 1 Name NORTH COMMUNITY HOUSE RD
 Stop Condition-Street 1 None
 Street 2 Name PARADISE RIDGE RD
 Stop Condition-Street 2 StopSign

